

ND-1000 Spectrophotometer

V3.3 User's Manual

NanoDrop Technologies, Inc. 3411 Silverside Road

Bancroft Building Wilmington, DE 19810 USA

Voice: 302-479-7707 Fax: 302-792-7155 Email: info@nanodrop.com www.nanodrop.com

NanoDrop is a registered trademark of NanoDrop Technologies, Inc. Other parties' trademarks are the property of their respective owners and should be treated as such.

Copyright © 2007 NanoDrop Technologies, Inc.

rev 3/2007

Table of Contents

1.	Overview Instrument Description. Operation. Applications Patents	1-1 1-1 1-1
2.	Initial Set Up Computer Requirements Software Installation Software Upgrades Registering Your Instrument	2-1 2-1 2-1 2-1
3.	General Operation	3-1 3-2 3-3 3-3 3-3 3-3
4.	Common Module Functions	4-6 4-6 4-6 4-7 4-7 4-7 4-7 4-7 4-7 4-8 4-8 4-8 4-8 4-8
5.	Nucleic Acids Sample Volume Requirements Measurement Concentration Range Spectrum Normalization Spectrum Overlay Control	5-1 5-1 5-2
6.	Fluorescent Dye Selection Sample Volume Requirements Measurement Concentration Range Baseline Calculation & Normalization	6-1 6-1 6-2
7.	UV-VIS	7-1 7-1
8.	Protein A280 Sample Volume Requirements Special Cleaning Requirements for Proteins Measurement Concentration Range Unique Screen Features Spectrum Normalization Spectrum Overlay Control	8-1 8-1 8-1 8-1 8-2
9.	Proteins & Labels Fluorescent Dye Selection Sample Volume Requirements Special Cleaning Requirements for Proteins	9-1 9-1

	Measurement Concentration Range 9-1 Unique Screen Features 9-1 Baseline Type 9-2
	Protein BCA10-1Sample Volume Requirements10-1Special Cleaning Requirements for Proteins10-1Measurement Concentration Range10-1BCA Kits, Protocols, and Sample Preparation10-1Unique Screen Features10-1Making BCA Measurements10-2Standard Curve Features10-2Exiting the BCA Module10-3
11.	Protein Lowry
12.	Protein Bradford12-1Sample Volume Requirement.12-1Special Cleaning Requirements for Proteins12-1Measurement Concentration Range12-1Bradford Kits, Protocols, and Sample Preparation12-1Unique Screen Features12-1Making Bradford Protein Measurements12-2Standard Curve Features12-3Exiting the Bradford Module12-3
13.	Cell Cultures13-1Sample Size Requirements13-1Cell Suspension Concentrations13-1Sample Homogeneity13-1Decontamination of Measurement Pedestals13-2
14.	Archived Data and Data Viewer14-1Archive File Creation14-1Data Storage Hierarchy14-1Data Viewer14-2Archive File Converter14-5Opening Archived Data with Spreadsheet Programs14-6
15.	Troubleshooting15-1Error USB200015-1Connection Error15-2Signal Error15-2Saturated Detector15-3Liquid Column Breakage15-3Other Software Error Messages15-4Sample Accuracy and Reproducibility15-5260/280 Ratio15-6Unusual Spectrum15-6Technical Service15-7
16.	Maintenance and Warranty16-1Cleaning16-1Calibration16-1Warranty16-1
17.	Appendices17-1Instrument Specifications17-1Blanking and Absorbance Calculations17-1Concentration Calculation (Beer's Law)17-1Solvent Compatibility17-2Decontamination of Measurement & Optical Surfaces17-2Setting Up a Dymo 400 Label Writer Printer17-2

1. Overview

Instrument Description

The NanoDrop[®] ND-1000 is a full-spectrum (220-750nm) spectrophotometer that measures 1 ul samples with high accuracy and reproducibility. It utilizes a patented sample retention technology that employs surface tension alone to hold the sample in place. This eliminates the need for cumbersome cuvettes and other sample containment devices and allows for clean up in seconds. In addition, the ND-1000 has the capability to measure highly concentrated samples without dilution (50X higher concentration than the samples measured by a standard cuvette spectrophotometer).

Operation

A 1 ul sample is pipetted onto the end of a fiber optic cable (the receiving fiber). A second fiber optic cable (the source fiber) is then brought into contact with the liquid sample causing the liquid to bridge the gap between the fiber optic ends. The gap is controlled to both 1mm and 0.2 mm paths. A pulsed xenon flash lamp provides the light source and a spectrometer utilizing a linear CCD array is used to analyze the light after passing through the sample. The instrument is controlled by special software run from a PC, and the data is logged in an archive file on the PC.

Applications

UV/VIS spectrophotometry is simple for samples as small as 1 ul using the NanoDrop[®] ND-1000 Spectrophotometer. The small sample requirement and ease of use make the NanoDrop[®] ND-1000 Spectrophotometer ideally suited for measuring:

- Nucleic acid concentration and purity of nucleic acid samples up to 3700 ng/ul (dsDNA) without dilution
- Fluorescent dye labeling density of nucleic acid microarray samples
- Purified protein analysis (A280) up to 100 mg/ml (BSA)
- Expanded spectrum measurement and quantitation of fluorescent dye labeled proteins, conjugates, and metalloproteins
- Bradford Assay analysis of protein
- BCA Assay analysis of protein
- Lowry Assay analysis of protein
- Cell density measurements
- General UV-Vis spectrophotometry

Patents

The sample retention technology used in the ND-1000 is covered under US patents 6,628,382 and 6,809,826. Other patents are pending.

2. Initial Set Up

Computer Requirements

The NanoDrop software will only run on an IBM compatible PC meeting the below criteria. No Mac versions of the software are currently available.

- Microsoft Windows XP or 2000 operating system.
 Windows Vista has also been tested successfully with NanoDrop software.
 <u>The operating software is not compatible with Windows NT, 95, 98 or ME.</u>
- 233 MHz or higher processor
- CD ROM drive
- 32 MB or more of RAM
- 40 MB of free hard disk space
- Open USB port (the instrument can only be connected via the USB port)
- Microsoft Excel or other spreadsheet program to manipulate archived data (optional)

Software Installation

WARNING: The system software must be loaded onto the PC before the USB cable is connected. Administrator access on the PC is required to install the software.

To properly install NanoDrop software:

- 1. Close all programs and make sure that the USB cable is unplugged.
- 2. Insert the operating software CD in the CD drive of the PC. The software installation menu should appear automatically. If software menu does not appear, choose 'My Computer' to view the contents of the CD. Double click on the file named 'nd-1000...install.exe'.
- After software installation, connect the USB cable and the Found New Hardware Wizard should start as shown below. (Windows XP SP2 operating system will ask to allow it to search the internet for the proper software as shown- Select 'No, not this time'). Follow the prompts for automatic installation of the software.



Intro Page: Windows XP- SP2

All Windows Operating Systems

Your NanoDrop[®] ND-1000 Spectrophotometer should now be ready for operation. If the software does not start properly, refer to the "Troubleshooting" section for possible solutions.

Configuring the System Font

The NanoDrop software is designed to look best with the MS Sans Serif font, 8 point. To check that the system font is set to the proper selection:

- 1. Open the 'Displays Properties' by right clicking on the desktop and select *Properties* → *Appearance*. (Additional step for Windows XP: click on the 'Advanced' button).
- 2. From 'item' list select 'icon'.
- 3. Select the 'MS Sans Serif (western)' font and select '8 point' size.
- 4. Click OK.

Other selections can be used, but may either cause some text in the NanoDrop software window to not fit well or result in the function selection tabs across the top to become inaccessible.

Software Upgrades

NanoDrop Technologies makes periodic upgrades to the NanoDrop software. These upgrades are available for download at www.nanodrop.com.

Cable Connections

To make measurements with the instrument, connect the USB cable to instrument and the PC, plug in the 12V power supply and connect to the power input at the back of the instrument.

Note: The power supply can remain plugged into the NanoDrop[®] ND-1000 Spectrophotometer while the instrument is not in use. When the unit is in this "standby" mode, power consumption is ~1.5 W and the flashlamp is not energized. Also, the instrument does not utilize a power switch or give a visual indication of the operability of the 12V power supply.

Registering Your Instrument

Please register your product! We periodically update our software and add new features free of charge. We would like to keep our user list updated so that we may alert you to these updates. All information supplied to NanoDrop Technologies is completely confidential. You can register at www.nanodrop.com.

3. General Operation


The Sample Retention System

Basic Use

The main steps for using the sample retention system are listed below:



1. With the sampling arm open, pipette the sample onto the lower measurement pedestal.

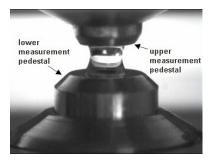

3. When the measurement is complete, open the sampling arm and wipe the sample from both the upper and lower pedestals using a soft laboratory wipe. Simple wiping prevents sample carryover in successive measurements for samples varying by more than 1000 fold in concentration. See www.nanodrop.com for performance data on sample carryover.



2. Close the sampling arm and

initiate a spectral measurement

PC. The sample column is automatically drawn between the upper and lower measurement pedestals and the spectral measurement made.

using the operating software on the

Cleaning the Sample Retention System

Wiping the sample from both the upper and lower pedestals (as shown above) upon completion of each sample measurement is usually sufficient to prevent sample carryover and avoid residue buildup. Although generally not necessary, 2 ul water aliquots can be used to clean the measurement surfaces after particularly high concentration samples to ensure no residual sample is retained on either pedestal. After measuring a large number of samples, however, it is recommended that the areas around the upper and lower pedestals be cleaned thoroughly. This will prevent the wiping after each measurement from carrying previous samples onto the measurement pedestals and affecting low-level measurements. A final cleaning of all surfaces with de-ionized water is also recommended after the user's last measurement.

Decontamination of Measurement Pedestals

If decontamination is necessary, a sanitizing solution, such as a 5.25% solution of sodium hypochlorite (bleach – freshly prepared), can be used to ensure that no biologically active material is present on the measurement pedestals. The metal fiber optic fittings are made from 303 stainless steel and are resistant to most common laboratory solvents (see "Solvent Compatibility" appendix).

Special Cleaning Requirements for Proteins

Proteins and solutions containing surfactants can "un-condition" the measurement pedestal surfaces so that the liquid column does not form well with 1ul samples. If this occurs, "buff" the measurement pedestal surfaces by rubbing each with a dry laboratory wipe 30-40 times. This will "re-condition" the surface allowing the liquid sample column to form.

Sample Size Requirements

Although sample size is not critical, it is essential that the liquid column be formed so that the gap between the upper and lower measurement pedestals is bridged with sample.

Field experience indicates that the following volumes are sufficient to ensure reproducibility:

- Aqueous solutions of nucleic acids: 1 ul
- Purified protein: 2 ul
- Bradford, BCA or Lowry assay: 2 ul
- Microbial cell suspensions: 1-2 ul

It is best to use a precision pipettor (0-2 ul) with precision tips to assure that sufficient sample (1-2 ul) is used. Lower precision pipettors (0-10 ul and larger) are not as good at delivering 1 ul volumes to the measurement pedestal. If you are unsure about your sample characteristics or pipettor accuracy, a 2 ul sample is recommended.

Sample Carryover

Prevention of sample being retained on the ND-1000 Spectrophotometer's measurement pedestals is easily addressed. Simple wiping of the upper and lower measurement pedestal with a dry laboratory wipe is highly effective in eliminating carryover for samples differing in concentration by as much as three orders of magnitude (see data at www.nanodrop.com). This is possible since each measurement pedestal is in actuality a highly polished end of a fiber optic cable. There are no cracks or crevices for residual sample to get trapped within.

Sample Homogeneity

Sampling from non-homogeneous solutions – particularly when using small volumes – can cause significant deviations in the data generated using all measurement technologies including spectrophotometry. Genomic DNA, lambda DNA and viscous solutions of other highly concentrated nucleic acids, such as resuspended nucleic acid preparations, are common examples known to the molecular biologist. Proteins are subject to denaturation, precipitation, and aggregation and therefore may require special handling to ensure sample homogeneity.

Effect of Evaporation and Solvents

Evaporation of the sample during the measurement cycle usually has just a minimal effect on absorbance readings and may result in a 1-2% increase in sample concentration. This can be observed in the field by measuring the same sample successively over time. Highly volatile solvents, such as hexane, will likely evaporate before the measurement can be completed. Less volatile solvents such as DMSO can be used successfully.

Sample Recovery

One of the advantages of the sample retention system is that samples can be recovered from the upper and lower measurement pedestals by extraction with a pipette.

Software Architecture and Features

Main Menu

With the sampling arm in the down position, start the NanoDrop software by selecting the following path: Start \rightarrow Programs \rightarrow NanoDrop \rightarrow ND-1000 (version)



Application Modules

The NanoDrop software has been tailored to meet the life scientist's needs. It includes the following application modules:

- Nucleic Acid concentration and purity of nucleic acid
- MicroArray dye incorporation concentration and purity of nucleic acid
- UV-Vis general UV-Vis measurements
- Cell Cultures "absorbance" (light scattering) measurement of suspended microbial cells
- Protein A280 concentration and purity of purified protein
- Proteins & Labels concentration of dye-labeled proteins, conjugates, and metalloproteins
- Protein BCA protein concentration using the BCA assay
- Protein Bradford protein concentration using the Bradford assay
- Protein Lowry protein concentration using the Modified Lowry assay

User Preferences

Each user has the option to configure a number of settings in the various application modules.

User Preference Help	05				Ele	iser Preference Help	•			
User Defaul	t	_			Γ	User Default		_		
Proteins & L	abels	Pro	tein A280	1		Proteins & Lo	abels		Protein A280	
Archiving	Reports	Nucleic Acids	UV-Vis Mic	roarray		Archiving	Reports	Nucleic Acid	s UV-Vis	Microarray
							Auto	Reporting		
P	rimary data stor C:WanoD	te data storage? age is always enab trop Data (Windows uplicate Data Fo	ed and located at systems).			Protei	Icleic Acids UV-Vis Microarray ns & Labels cell Cultures	Protei Protein Bro Protein	n A280 🔀 in BCA 🔀 adford 🔀 Lowry 🔀	
	_	ts and Settings\dsc						It Reports		100
		plicate storage	onkang, sama			Module Nucleic Acid	Custom	Report d Nucleic Acid re		4
		,				MicroArrey		rd Microarray repo		
	-					UV-Vis		rd UV-Vis report to		Select
						Protein A-280		rd Protein A-280 re		Custom
						Cell Culture		rd Cell Culture rep		Report
						Proteins & Lal		rd Proteins & Labe		df Format
						BCA Protein		rd BCA protein rep		
						Bradford		rd Bradford report		-
						Lowry		rd Lowry report for		T Select u
		Sav	e & Exit C	ancel				s	ave & Exit	Cancel

The user preferences options for each application module are self explanatory.

Some key features include:

Duplicate data storage

In addition to the primary data storage of archive files at c:\nanodrop data, users may elect to save their data to an additional location. This option can be chosen under the 'Archiving.' tab by selecting the 'Duplicate data storage?' box and then choosing the file path by clicking on the file folder icon under 'Duplicate Data Folder'. Save the alternative path by clicking on the 'Save Preferences' button before exiting the User Preferences module.

Auto Reporting

Users may choose to select the 'Auto Reporting' option for any of the application modules. The auto reporting option allows data to automatically be saved to the report for all samples. Users may choose this option under the Report tab by selecting the corresponding box next to the modules listed under 'Auto Reporting'. Save the auto reporting functions by clicking on the 'Save Preferences' button before exiting the User Preferences window.

Note: User preferences are stored in a '.log' file. When upgrading to a newer version of the software, this file should be preserved. If after upgrading to a new software version the user preferences do not appear correctly, the .log file should be manually copied to the proper directory. See "Passwords. log" for more detail.

Utilities and Diagnostics

This module is used to help troubleshoot operational problems with the instrument. For more information on using this module, refer to the "Troubleshooting" section of this manual.

Account Management

The Account Management module provides options for directing where specific data files are archived, allowing users to segregate their data into personal folders. The Account Management module is accessible to the administrator only.

Account Types

There are three types of user accounts:

Level 10- this is the highest security setting and all level 10 users can add new users, modify a user, delete a user and set password options. At the time of software installation, the only level 10 account is Administrator whose initial password is "nanodrop". It is strongly

recommended that the password be changed after initial account set up. Any user can be set to a level 10 access, although this is not recommended (see Level 5 below). Note: The administrator (or the last level 10 user) account may not be deleted.

User Acces	ss Manager						
ctions							
			All Use	ws.			
User ID Default Administrator	Full Name Administrator	0 10	Active Active	Not Locked	Expired Not Expired Not Expired		1.4
joel	same	5	Active	Not Locked	Not Expired	6/14/2007 10:23:05 AM	
			_				-
	-	-	_	-			

Level 5- this is the security setting recommended for an ordinary user account. An account with this access will be password protected and will be able to select specific user preferences. Also, all data generated will be automatically archived in to the user's account in *c:\nanodrop data* (and the user specified location if that preference is selected).

Default (level 0 security) - this access level is reserved for the Default account only. This account enables any user without an account to access all the active software measurement modules. Although it is not password protected, user preferences can be set for this account. All data generated will be automatically archived into the Default folder within the *c:Wanodrop Data* folder. Note: For laboratories requiring that every user have a unique user-account, the administrator may disable the default user account.

Account Log-in/Log-out and Time Out

The user's account will remain active until 1) a user logs out of his/her account by using the pull down menu to select either Default or another user name or 2) the user closes the software.

A user account may also be logged out automatically if the software "System Idle Timeout" is exceeded. After 4 hours of inactivity the software account will automatically revert back to the Default user. A screen will appear indicating that the time is about to expire, with a 30-second countdown. If the user elects 'CANCEL', the clock with reset and the user account and application module will remain active for another 4 hours. If the time expires, the open application module will close, returning to the Main Menu and the Default user.

Account Lockout

User-specific accounts can become locked out in several ways as noted below:

- Failure to change password within the allotted time
- Incorrectly entering the password 99 consecutive times
- The administrator locks a specific account

Only the administrator (level 10) can unlock a locked account. This is done by using the 'Modify User' entry in the Account Management module. Note: All accounts (even the administrator) can be locked if the incorrect password entry occurs as described above.

Change Password

This module enables each user having an authorized account ID to change their respective password.

Note: The administrator, using the 'Options' or the 'Modify User' entries in the 'Account Management' module, establishes whether individual user passwords will expire and, if so, after how many days.

Continue to save or	er parameters and click r Cancel to exit without aving
Active?	\boxtimes
User ID	joel
Full Name	same
Password	
Password (repeat)	danak
Security level	5
Expires	10:23:05:506 AM 6/14/2007

Passwords.log file

This file contains the User ID & password for all accounts and is readable only by the software. It can be found in the c:\nanodrop data\log files folder. It is strongly recommended that the administrator make a copy of that file and store it in the same log files folder as above each time a new user account is added or a password is changed. If the administrator's account becomes locked, the up-to-date copy can be renamed and used as the password,log file.

Note: If upgrading from a previous version, the "passwords.log" and "user preferences.log" files should be automatically copied to the c:\VanoDrop Data\Log Files directory. If for some reason these files are not copied automatically, they must be manually copied from the c:\program files\VanoDrop {version} to the c:\program files\VanoDrop V(version) directory.

Dye/Chromophore Editor

The Dye/Chromophore Editor gives the user the ability to add their own dyes or chromophores in addition to the predefined fluorescent dyes available for use with the MicroArray and Proteins and Labels modules. Note 1: Predefined dye methods are indicated by a diamond and can't be modified. Note 2: Absorbance contribution at 260nm from the respective dye can be corrected by entering the appropriate decimal correction in the 260nm % field. Refer to the following Molecular probes Base:Dye Ratio Calculator to find the 260 nm % factor for dyes not pre-defined in the Dye/Chromophore List: http://probes.invitrogen.com/resources/calc/basedyeratio.html

Note: If upgrading from a previous version, zero values (0) for 260 nm % and 280 nm % correction factors will be entered for all user defined dyes. Please refer to the above link for a list of the correct factors to manually enter.


Dy	/e/Chromo	phore	e List		
Name	1/M-cm	nm	260 nm %	280 nm % 🔺	Insert
♦ Cy3	1.50E+5	550	0.04	0.05	Below
♦ Cy6	2.50E+5	650	0.00	0.05	
 Alexa Fluor 488 	7.10E+4	495	0.30	0.11	Delete
 Alexa Fluor 546 	1.04E+5	556	0.21	0.12	Selected
 Alexa Fluor 555 	1.50E+5	555	0.04	0.08	
 Alexa Fluor 594 	7.30E+4	590	0.43	0.56	Edit
 Alexa Fluor 647 	2.39E+5	650	0.00	0.03	Selected
 Alexa Fluor 660 	1.32E+5	663	0.00	0.10	
• Cy3.5	1.50E+5	581	0.08	0.24	
• Cy5.5	2.50E+5	675	0.05	0.18	
					Save
				*	Exit

4. Common Module Functions



Module Startup

When the software starts, you should see this message:

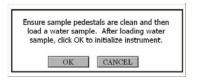

For best results, **ensure measurement pedestal surfaces are clean** and load a water sample onto the lower measurement pedestal and then click 'OK'. After clicking OK, the message **"Initializing Spectrometer- please wait**" will appear. When this message disappears, the instrument will be ready for use. All data taken will automatically be logged in the appropriate archive file.

Escape Key (ESC)

The escape key is set to exit out of all screens. Hitting the escape key twice will log the user out of an application module.

Measure (F1)

Each time a software module is opened (initiated), the Measure' button is inactive as noted by its "grayed-out" appearance. A blank must first be measured before the Measure button will become active.

The Measure button is used to initiate the measurement sequence for all samples (non-blanks). It is actuated by depressing the F1 key or clicking the 'Measure' button. The entire measurement cycle takes approximately 10 seconds.

Blank (F3)

Before making a sample measurement, a blank must be measured and stored (see "Blanking and Absorbance Calculations" in the appendix for more details on absorbance calculations). After making an initial blank measurement, a straight line will appear on the screen; subsequent blanks will clear any sample spectrum and display a straight line as shown in the image below.

	ank Print Screen		User	18/27/2005 11:20 Exit Default
1.96~	Overlay control	Accumulate until clear		Sample DNA-50
1.80 -				Sample Blank
1.20-				Sample / 3
0.80-				λ 230 Abs. 0.000 A-260 10 mm path 0.000
0.40-				A-280 10 mm path 0.000 260/280 NaN 260/230 NaN

Blanking Cycle

For the most consistent results, it is best to begin any measurement session with a blanking cycle. This will assure the user that the instrument is working well and that any non-specific fluorescence is not a concern. To perform a blanking cycle, perform the following:

- 1. Load a blank sample (the buffer, solvent, or carrier liquid used with your samples) onto the lower measurement pedestal and lower the sampling arm into the 'down' position.
- 2. Click on the 'Blank' (F3) button.
- 3. Wipe the blanking buffer from both pedestals using a laboratory wipe.
- 4. Analyze an aliquot of the blanking solution as though it were a sample. This is done using the 'Measure' button (F1). The result should be a spectrum with a relatively flat baseline. Wipe the blank from both measurement pedestal surfaces and repeat the process until the spectrum is flat.

See "Blanking and Absorbance Calculations" in the appendix for more information on blanking and absorbance calculations.

Re-blank (F2)

The Re-blanking option (F2) establishes a new reference (blank) that is used for the absorbance calculations of subsequent samples. However, unlike the Blank (F3) function, the Re-blank feature recalculates the absorbance spectrum for the most recent sample and displays this on the screen. When the Re-blank function is used, the following message appears:

Blank Applied To displayed	
Spectrum	

See the "Blanking and Absorbance Calculations" appendix for more information on absorbance calculations.

Print Screen (F4)

The 'Print Screen' button will print a copy of the current operating screen to the default printer attached to the operating PC.

Note: The system is configured to work with the Dymo Label Writer 400 printing on #30256 [2-5/16' X 4'] shipping labels, but can print on any printer connected to the PC.

Print Window

A Print dialogue can be initiated from the 'File' pull-down menu or by typing 'Ctrl+P'. The user can specify any connected printer to print to from the Print dialogue.

Saving Current Screen as .JPG Image

The current screen can be saved as a .jpg image file by selecting 'Save Window' from the 'File' pull down menu.

Start Report / Recording (F6)

The user can log measurement results in a report table and print them to the desired printer. To initiate this feature, select the 'Start Report' button. The default setting has the Recording feature activated. Refer to section 14 (Data Viewer) for additional details. Note: To override this feature, click on the 'Recording' button. Once de-selected, the button will read Start Report.

When the maximum number of entries for that specific report has been reached, there are 2 options:

Print Report & Clear or

Save Report & Clear.

Repo	1			Test	ype:	_				[Xr20/200	6 1 43	Exit
port Nar	ne						Max B.	iffer Size[200	Buffer I	łode 🛛	/ Save F	Report & Clear
	Sample ID	Date	Time	Ngn	A260	A280	260/280	260/230	Constant	Cursor Post	Oursor abs	340 1000	Type
	_									-	-		
	_												
	_												

All data is stored in the archive file at c:WanoDrop Data (and in a duplicate location if selected in User Preferences).

Note: This feature can be set so that 'Recording' is the default mode. See "User Preferences" in section 3 for more information.

Print Report (F5)

Selecting the 'Print Report' (F5) button will print the existing sample report to the default printer. It can be configured to clear the sample report contents. The user also has options as to how the buffer is handled. Refer to section 14 (Data Viewer) for additional details. All data is stored in the archive file at *c:WanoDrop Data*.

Note: The system is configured to work with the Dymo Label Writer 400 printing on #30256 [2-5/16' X 4'] shipping labels, but can print to any printer connected to the PC.

Show Report (F7)

The user can display the entries comprising the current Sample Report at any time by selecting the 'Show Report' button. This function will enable the Data Viewer software described in section 14. Parameters specific for the individual application modules are populated for each individual Sample ID. Descriptive parameters specific for the individual application modules are populated for each individual sample ID.

Sample ID

The 'Sample ID' is highlighted for overtyping or barcode scanning. The user may input a sample ID that will be used to identify the measurement in a report print and in the archived data file. The sample ID entry is "key focused", meaning it is the default selection on the screen and should have a flashing text cursor when the instrument is waiting to make a new measurement.

Sample

The 'Sample #' indicator is activated when a sample report is being recorded. It indicates the sample number of the last sample processed in the current report and increments with each successive measurement until the sample report is fully populated. The sample buffer limit can be modified on the report page.

Exit

This command closes all application modules and supporting options. After clicking the 'Exit' button, the user has 10 seconds to cancel the exit command. If no action is taken within 10 seconds, the exit command is carried out. Note: All measurement data is automatically saved to an archive file and requires no user action.

Show Context Help


Context Help is enabled in the Main Menu, all function modules, and the application modules. The help feature is enabled by choosing 'Show Context Help' from the 'Help' menu pull down or by selecting 'Ctrl+H'. Once enabled, placing the cursor on elements of the screen will automatically generate an explanation of that element. Context Help remains active until deselected.

User's Manual

A .PDF version of this User's Manual is accessible from the Main Menu and from the Help menu in all of the application modules. It can also be accessed by selecting from the Help pull down menu in any application module or from *Start* \rightarrow *Programs* \rightarrow *NanoDrop* \rightarrow *ND-1000 (version).*

5. Nucleic Acids

Nucleic acid samples can be readily checked for concentration and quality using the NanoDrop[®] ND-1000 Spectrophotometer. To measure nucleic acid samples select the 'Nucleic Acid' application module.

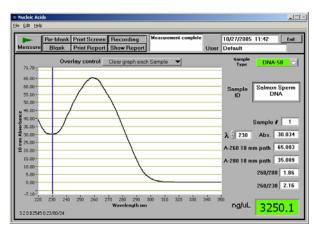

Sample Volume Requirements

Field experience has indicated that 1ul samples are sufficient to ensure accurate and reproducible results when measuring aqueous nucleic acid samples. However, if you are unsure about your sample or your pipettor accuracy, a 1.5-2ul sample is recommended to ensure that the liquid sample column is formed and the light path is completely covered by sample.

Measurement Concentration Range

The NanoDrop[®] ND-1000 Spectrophotometer will accurately measure dsDNA samples up to 3700 ng/ul without dilution. To do this, the instrument automatically detects the high concentration and utilizes the 0.2mm pathlength to calculate the absorbance.

Detection	Approx.	Typical Reproducibility				
Limit	Upper Limit	(minimum 5 replicates)				
(ng/ul)	(ng/ul)	(SD= ng/ul; CV= %)				
2	3700 ng/ul (dsDNA) 3000 (RNA) 2400 (ssDNA)	sample range 2-100 ng/ul: \pm 2 ng/ul sample range >100 ng/ul: \pm 2%				

Unique Screen Features

Sample Type: used to select the (color-keyed) type of nucleic acid being measured. The user can select 'DNA-50' for dsDNA, 'RNA-40' for RNA, 'ssDNA-33' for single-stranded DNA, or 'Other' for other nucleic acids. The default is DNA-50. If 'Other' is selected, the user can select an analysis constant between15-150. When navigating amongst the three general sample types within the Nucleic Acids module, the last constant value entered within the 'Constant' sample type will be retained. See the "Concentration Calculation (Beer's Law)" Appendix for more details on this calculation.

 λ and **Abs**: the user selected wavelength and corresponding absorbance. The wavelength can be selected by moving the cursor or using the up/down arrows to the left of the wavelength box.

Note: The user-selected wavelength and absorbance are not utilized in any calculations.

A260: absorbance of the sample at 260 nm represented as if measured with a conventional 10 mm path. <u>Note</u>: This is 10X the absorbance actually measured using the 1 mm path length and 50X the absorbance actually measured using the 0.2 mm path length.

<u>A280</u>: sample absorbance at 280 nm represented as if measured with a conventional 10 mm path. <u>Note</u>: This is 10X the absorbance actually measured using the 1 mm path length and 50X the absorbance actually measured using the 0.2 mm path length.

260/280: ratio of sample absorbance at 260 and 280 nm. The ratio of absorbance at 260 and 280 nm is used to assess the purity of DNA and RNA. A ratio of ~1.8 is generally accepted as "pure" for DNA; a ratio of ~2.0 is generally accepted as "pure" for RNA. If the ratio is appreciably lower in either case, it may indicate the presence of protein, phenol or other contaminants that absorb strongly at or near 280 nm. See "260/280 Ratio" section of the Troubleshooting section for more details on factors that can affect this ratio.

<u>260/230</u>: ratio of sample absorbance at 260 and 230 nm. This is a secondary measure of nucleic acid purity. The 260/230 values for "pure" nucleic acid are often higher than the respective 260/280 values. They are commonly in the range of 1.8-2.2. If the ratio is appreciably lower, this may indicate the presence of co-purified contaminants.

ng/ul: sample concentration in ng/ul based on absorbance at 260 nm and the selected analysis constant. See the "Concentration Calculation (Beer's Law)" in the appendix for more details on this calculation.


Show Report: formatted for 200 samples although the buffer size can be increased to accommodate thousands of samples.

Spectrum Normalization

The baseline is automatically set to the absorbance value of the sample at 340 nm, which should be very nearly zero absorbance. All spectra are referenced off of this zero.

Spectrum Overlay Control

The user can display more than one spectrum in the same display using this feature. The current sample plot will be displayed in bold and previous plots will be distinguished by different colors. See example below:

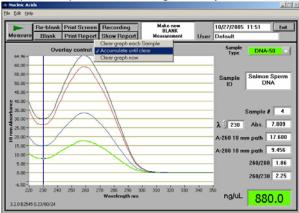

The default option is set to clear the display for the next reading. The user may set the overlay control to clear after each sample plot, (default setting), after each new report, or accumulate plots until prompted to clear. The Clear Now setting will clear all current and previous plots. When the overlay function is active, the software will auto scale the y-axis based on the sample with the highest absorbance at 260 nm. Note: When the overlay function is active, the 'Blank' function does not clear the existing overlaid sample spectra.

6. MicroArray


The capability to pre-select viable fluorescent-tagged hybridization probes for gene expression in microarrays can eliminate potentially flawed samples and improve research effectiveness. The NanoDrop[®] ND-1000 Spectrophotometer measures the absorbance of the fluorescent dye, allowing detection at dye concentrations as low as 0.2 picomole per microliter.

Fluorescent Dye Selection

There are currently nine fluorescent dyes that are hard-coded for use with the MicroArray module (see table below). Users can also enter & save fluorescent dyes not coded within the ND-1000 software using the 'Dye/Chromophore Editor' button found in the main menu.

Dyes can be selected using the scroll arrows or by highlighting the Dye 1 or Dye 2 box. The respective absorbance wavelength, extinction coefficient, and 260nm and 280nm % corrections will be automatically utilized for measurement and concentration calculation. The default settings from NanoDrop remain Dye 1 set to Cy3 and Dye 2 set to Cy5. In addition to the fluorescent dyes available from the drop-down menu, an option entitled 'None' is also available. Selecting 'None' disables the respective calculations & numeric displays corresponding to that dye.

Note: Please refer to the dye manufacturer for the appropriate correction factors for user entered dyes.

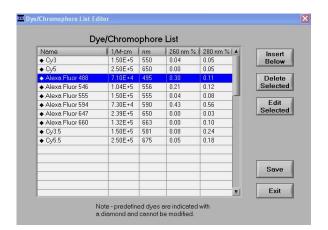

Sample Volume Requirements


Field experience has indicated that 1 ul samples are sufficient to ensure accurate and reproducible results when measuring aqueous nucleic acid samples containing incorporated fluorescent dyes. However, if you are unsure about the surface tension properties of your sample or your pipettor accuracy, a 1.5-2 ul sample is recommended to ensure that the liquid sample column is formed and the light path is completely covered by sample.

Measurement Concentration Range

The NanoDrop[®] ND-1000 Spectrophotometer will accurately measure fluorescent-dye and nucleic acid concentrations up to 100 pmols/ul (Cy3) and 750 ng/ul (DNA) respectively without dilution. A table of sample concentration ranges is listed below.

Sample Type	Detection Limit (pmol/ul)	Approx. Upper Limit (pmol/ul)	Typical Reproducibility (minimum 5 replicates) (SD= pmol/ul; CV= %)
Cy3, Cy3.5, Alexa Fluor 555 and Alexa Fluor 660	0.20	100	sample range 0.20-4.0 pmol/ul: ± 0.20 pmol/ul sample range >4.0 pmol/ul: ± 2%
Cy5, Cy5.5 and Alexa Fluor 647	0.12	60	sample range 0.12-2.4 pmol/ul: ± 0.12 pmol/ul sample range >2.4 pmol/ul: ± 2%
Alexa Fluor 488 and Alexa Fluor 594	0.40	215	sample range 0.40-8.0 pmol/ul: ± 0.40 pmol/ul sample range >8.0 pmol/ul: ± 2%
Alexa Fluor 546	a Fluor 546 0.30		sample range 0.30-6.0 pmol/ul: ± 0.30 pmol/ul sample range >6.0 pmol/ul: ± 2%

Unique Screen Features

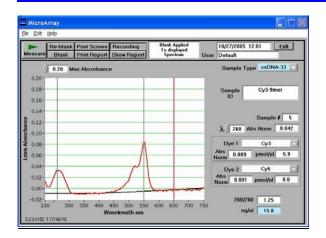

Max Absorbance: used to rescale the upper limit of the vertical axis.

Sample Type: used to select the (color-keyed) type of nucleic acid being measured. The user can select 'DNA-50' for dsDNA, 'RNA-40' for RNA, ssDNA-33' for single-stranded DNA, or 'Other' for other nucleic acids. The default is ssDNA-33'. If 'other' is selected, the user can select an analysis constant between 15-150. When navigating amongst the three (3) general sample types within the Micro Array module, the last value of the constant entered within the 'Constant' Sample Type will be retained. See "Concentration Calculation (Beer's Law)" in the appendix for more details on this calculation.

 λ and **Abs**: the user selected wavelength (black cursor) and corresponding absorbance at the 1mm pathlength. The wavelength can be selected by dragging the black cursor or using the up/down arrows to the left of the wavelength box. Note: The user-selected wavelength and absorbance at the 1 mm pathlength are not utilized in any calculations.

Dye 1 (or 2): user selected dye

Abs. Norm: normalized absorbance of selected Dye at the 1 mm pathlength.

pmol/ul: concentration based upon selected Dye's extinction coefficient. See "Concentration Calculation (Beer's Law)" in the appendix for more details on this calculation.

ng/ul: concentration of nucleic acids in the sample calculated using the absorbance at 260 nm minus the absorbance at 340 nm (i.e. normalized at 340 nm) and the nucleic acid analysis constant. See "Concentration Calculation (Beer's Law)" in the appendix for more details on this calculation.

Show Report: formatted for 200 samples although the buffer size can be increased to accommodate thousands of samples.

260/280: ratio of sample absorbance at 260 and 280 nm. The ratio of absorbance at 260 and 280 nm is used to assess the purity of DNA and RNA. A ratio of ~1.8 is generally accepted as "pure" for DNA; a ratio of ~2.0 is generally accepted as "pure" for RNA. If the ratio is appreciably lower in either case, it may indicate the presence of protein, phenol or other contaminants that absorb strongly at or near 280 nm. See "260/280 Ratio" section of the Troubleshooting section for more details on factors that can affect this ratio.

Baseline Calculation & Normalization

The software normalizes the visual spectrum display for all readings at 750nm and will automatically calculate a baseline between 400 and 750 nm for dye concentration calculations. The green vertical line on the screen represents the peak wavelength position for Dye 1, and the red vertical line represents the peak wavelength position for Dye 2.

7. UV-VIS

The 'UV/VIS Absorbance' module allows the NanoDrop[®] ND-1000 Spectrophotometer to function as a conventional spectrophotometer. Sample absorbance is displayed on the screen from 220 nm to 750 nm and cursors permit the measurement of individual peaks.


Sample Volume Requirements

Field experience has indicated that 1 ul samples are sufficient to ensure accurate and reproducible results when measuring most aqueous samples. If you are unsure about your sample composition or your pipettor accuracy, a 1.5-2 ul sample is recommended to ensure that the liquid sample column is formed and the light path completely is covered by sample.

Measurement Concentration Range

All ND-1000 spectrophotometers will measure absorbance up to the 10mm pathlength equivalent of 15 A. ND-1000s with serial numbers >500 or those that have been field retrofitted, can utilize the short path length (0.2mm) which enables the 10mm pathlength equivalent of 75 A.

Unique Screen Features

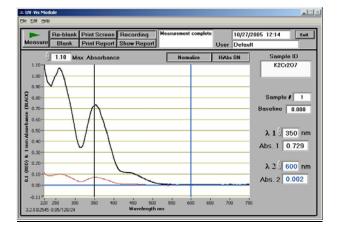

 λ 1/Abs1 and λ 2/Abs2: current values of the user-selectable wavelength cursors and corresponding absorbencies for a 1 mm pathlength. The wavelengths can be set by dragging the cursor, using the up/down arrows or typing in the desired wavelength.

Baseline: the absorbance of the user selectable-baseline (horizontal) cursor. The user may drag this cursor to a new vertical position to create a new baseline. The absorbance value of the baseline is subtracted from the absorbance of the spectrum.

Max Absorbance: used to rescale the upper limit of the vertical axis.

<u>Hi Abs</u>: samples with high absorbance (up to 75 A equivalent @ 10 mm path) can be measured directly (applicable for instruments with serial numbers >500 only or that have been field-retrofitted). This capability is selected by choosing the 'Hi Abs' button on the header bar. When this is selected, the absorbance is measured using the short path (0.2mm) and plotted as a red line normalized to a 0.1mm path for easier visual comparison as shown above. Sample ID label will be stored with sample data in the file folder *"C:WanoDrop Data\User name\ HiAbs"*. This data cannot be imported into the Data Viewer but can be opened with Excel type spreadsheets.

Normalize: This is a user-selectable feature in this module. If selected, the software will automatically normalize the spectrum based on the lowest absorbance value in the range 400-700 nm.

Show Report: formatted for 200 samples although the buffer size can be increased to accommodate thousands of samples.

8. Protein A280

Proteins, unlike nucleic acids, can exhibit considerable diversity. The A280 method is applicable to purified proteins exhibiting absorbance at 280nm. It does not require generation of a standard curve and is ready for quantitation of protein samples at startup. This module displays the UV spectrum, measures the protein's absorbance at 280 nm (A280) and calculates the concentration (mg/ml). Like the Nucleic Acid module, it automatically switches to the 0.2 mm pathlength at very high concentrations of protein. Also analogous to the Nucleic Acid module, the Protein A280 module displays and records 10 mm (1 cm) equivalent data on the screen and in the archived data file.

Sample Volume Requirements

Some proteins are hydrophobic and others hydrophilic giving rise to variable surface tension in the sample to be measured. Additionally the presence of surfactants or detergents in reagents, such as the Bradford reagent, can significantly alter surface tension. That occurrence can be overcome without affecting the sample's absorbance by using a larger sample volume. **A 2 ul sample size is recommended for protein measurements**.

Special Cleaning Requirements for Proteins


Proteins and solutions containing surfactants are known to "un-condition" the measurement pedestal surfaces so that the liquid column does not form. If this occurs, "buff" the measurement pedestal surfaces by rubbing each with a dry laboratory wipe 15-20 times. This will "re-condition" the surface allowing for the liquid sample column to form.

Measurement Concentration Range

The NanoDrop[®] ND-1000 Spectrophotometer will accurately measure protein samples up to 100 mg/ml (BSA) without dilution. To do this, the instrument automatically detects the high concentration and utilizes the 0.2mm pathlength to calculate the absorbance. A table of concentration range and typical reproducibility is listed below.

Sample Type	ample Type Detection Approx. Upper (minimum 5 replicates) Limit Limit (SD= mg/ml; CV= %)			
Purified BSA	0.10 mg/ml	100 mg/ml	sample range 0.05-10 mg/ml: ± 0.10 mg/ml sample range >10mg/ml: ± 2%	

Unique Screen Features

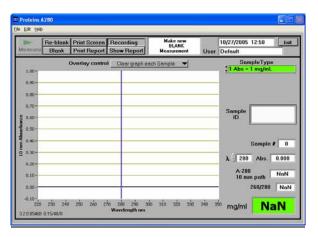

Sample Type: There are six sample types (options) available for purified protein analysis and concentration measurement. All of the options can be viewed by clicking the mouse while it is positioned within the 'Sample Type' box. The sample type (color-keyed) can be selected by clicking on the preferred option or by scrolling through the selections using the up or down arrow keys located to the left of the sample type box. A description of each sample type is given below.

SampleType 1 Abs = 1 mg/mL	A general reference setting based on a 0.1% (1 mg/ml) protein solution producing an Absorbance at 280 nm of 1.0 A (where the pathlength is 10 mm or 1 cm).	
SampleType BSA	Bovine Serum Albumin reference. Unknown (sample) protein concentrations are calculated using the mass extinction coefficient of 6.7 at 280 nm for a 1% (10 mg/ml) BSA solution.	

SampleType JIgG	IgG reference. Unknown (sample) protein concentrations are calculated using the mass extinction coefficient of 13.7 at 280 nm for a 1% (10 mg/ml) IgG solution.
SampleType	Lysozyme reference. Unknown (sample) protein concentrations are calculated using the mass extinction coefficient of 26.4 at 280 nm for a 1% (10 mg/ml) Lysozyme solution.
SampleType Other protein (E & MW) e (x1000) M.W. (kDa) 50.00	User-entered values for molar extinction coefficient (M ⁻¹ cm ⁻¹) and molecular weight (MW) in kilo Daltons for their respective protein reference. Maximum value for e is 999 X 1000 and maximum value for M.W. is 9999 X 1000.
SampleType Other protein (E 1%) Ext. Coeff. E 1% L/gm-cm	User-entered mass extinction coefficient (L gm ⁻¹ cm ⁻¹) for a 10 mg/ml (1%) solution of the respective reference protein.

 λ and A: current value of the user-selectable wavelength cursor and corresponding absorbance. The wavelength can be set by dragging the cursor, using the up/down arrows or typing in the desired wavelength. Note: The user-selected wavelength and absorbance are not utilized in any calculations.

A280 10-mm Path: 10 mm-equivalent absorbance at 280 nm for the protein sample measured

A260/280: ratio of sample absorbance at 260 and 280 nm


Show Report: formatted for 200 samples although the buffer size can be increased to accommodate thousands of samples.

Spectrum Normalization

The baseline is automatically set to the absorbance value of the sample at 340 nm, which should be very nearly zero absorbance. All spectra are referenced off of this zero. All data are now normalized and archived in the same format.

Spectrum Overlay Control

The user can display more than one spectrum in the same display using this feature. The current sample plot will be displayed in bold and previous plots will be distinguished by different colors. See example below:

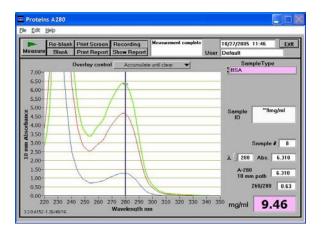

The default option is set to clear the display for the next reading. The user may set the overlay control to clear after each sample plot (default setting), after each new report, or accumulate plots until prompted to clear. The clear now setting will clear all current and previous plots. When the overlay function is active, the software module will auto scale the y-axis based on the sample with the highest absorbance at 280nm. Note: When the overlay function is active, the 'Blank' function doesn't clear the existing overlaid sample spectra.

9. Proteins & Labels


This software module can be used to determine protein concentration (A280nm) as well as fluorescent dye concentration (protein array conjugates), or to measure the purity of metalloproteins (such as hemoglobin) using wavelength ratios.

Fluorescent Dye Selection

There are currently nine fluorescent dyes that are hard-coded for use with the Proteins and Labels module (see table below). Users can also enter & save fluorescent dyes not coded within the ND-1000 software using the 'Dye/Chromophore Editor' button found in the main menu.

Dyes can be selected using the scroll arrows or by highlighting the Dye 1 or Dye 2 box. The respective absorbance wavelength, extinction coefficient, and 280nm % corrections will be automatically utilized for measurement and concentration calculation. The default settings from NanoDrop remain Dye 1 set to Cy3 and Dye 2 set to Cy5. In addition to the fluorescent dyes available from the drop-down menu, an option entitled 'None' is also available. Selecting 'None' disables the respective calculations & numeric displays corresponding to that dye.

Note: Please refer to the dye manufacturer for the appropriate correction factors for user entered dyes.

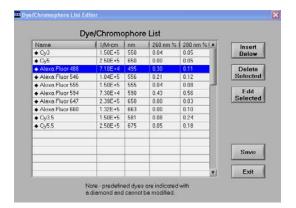

Sample Volume Requirements

Some proteins are hydrophobic and others hydrophilic giving rise to variable surface tension in the samples to be measured. Additionally the presence of surfactants or detergents in reagents, such as the Bradford reagent, can significantly alter surface tension. This occurrence can be overcome without affecting the sample's absorbance by using a larger sample volume. **A 2 ul sample size is recommended for protein measurements.**

Special Cleaning Requirements for Proteins

Proteins and solutions containing surfactants are known to "un-condition" the measurement pedestal surfaces so that the liquid column does not form. If this occurs, "buff" the measurement pedestal surfaces by rubbing each with a dry laboratory wipe 15-20 times. This will "re-condition" the surface allowing for the liquid sample column to form.

Measurement Concentration Range

The NanoDrop[®] ND-1000 Spectrophotometer will accurately measure protein samples up to 20 mg/ml (BSA) without dilution. A table of concentration range and typical reproducibility is listed below.

Sample Type	•		Typical Reproducibility (minimum 5 replicates) (SD= mg/ml; CV= %)
Purified BSA	0.10 mg/ml	20 mg/ml	sample range 0.05-10 mg/ml: ± 0.10 mg/ml sample range >10mg/ml: ± 2%
СуЗ	0.2uM	100uM	sample range 0.20-4.0 pmol/ul: \pm 0.20 pmol/ul sample range >4.0 pmol/ul: \pm 2%

Unique Screen Features

easure	Re-blank Blank	Print Screen Print Report	Recording Show Report	Make new BLANK Heaswement	User	10/27/200 Default	5 11:10 Exit
ax Abs 5.00-	orbance	5.00	Baseline Typ	e 750 nm	7	Sample ID Type 11gG	"2mg/ml lgG-FITC
3.00- 2.50- 2.00- 1.50-	V		Д		λ3 (] 2		Sample # 6 Abs @ λ 3 3.616 equivalent absorbance
1.00- 0.50-	1	\sim			Norm @3		FITC 24 uM 48.5

Max Absorbance: used to rescale the upper limit of the vertical axis.

Sample Type: The same six sample types (options) listed under Protein A280 (Section 8) are available for purified Proteins & Labels analysis and concentration measurement. All of the options can be viewed by clicking the mouse while it is positioned within the sample type box. The sample type (color-keyed) can be selected by clicking on the preferred option or by scrolling through the selections using the up or down arrow keys located to the left of the sample type box. See Protein A280 (Section 8) for a detailed description of each sample type.

 λ 3: user-selected wavelength

Norm Abs @ λ **3**: 10mm equivalent normalized absorbance at the respective wavelength.

Dye 1 (or 2): user-selected dye

Norm Abs @ λ 1: normalized 10 mm equivalent absorbance of selected Dye

<u>uM</u>: concentration based upon selected Dye's extinction coefficient. See the "Concentration Calculation (Beer's Law)" Appendix for more details on this calculation.

Abs ratio $\lambda 1/\lambda 3$: ratio of the absorbance of Dye 1 to the absorbance at the user-selected wavelength ($\lambda 3$).

mg/ml: concentration of proteins in the sample calculated using the absorbance at 280 nm minus the absorbance at 340 nm (i.e. normalized at 340 nm). See the "Concentration Calculation (Beer's Law)" Appendix for more details on this calculation.

Show Report: formatted for 200 samples although the buffer size can be increased to accommodate thousands of samples.

Baseline Type

This application module has two user-selectable "Baseline Type" options. The default setting is set to normalize the display spectrum at 750nm. Alternatively, the 400-750 Slope Baseline Type will normalize the display at 750nm and accommodate any linear baseline offset across the 400 to 750nm range.

10. Protein BCA

The BCA (Bicinchoninic Acid) Protein Assay is an alternative method for determining protein concentration. It is often used for more dilute protein solutions and/or in the presence of components that also have significant UV (280 nm) absorbance. Unlike the Protein A280 method, the BCA Assay requires a standard curve to be generated each time it is run, before unknown proteins can be measured. The resulting Cu-BCA chelate formed in the presence of protein is measured at its wavelength maximum of 562 nm and normalized at 750 nm. Pre-formulated reagents of BCA and CuSO₄, utilized in the assay, are available in kit form from numerous manufacturers. Follow their recommendations when mixing the respective reagents at the time the assay is to be performed.

Sample Volume Requirements

Some proteins are hydrophobic and others hydrophilic giving rise to variable surface tension in the sample to be measured. Additionally the presence of surfactants or detergents in reagents, such as the Bradford reagent, can significantly alter surface tension. This occurrence can be overcome without affecting the sample's absorbance by using a larger sample volume. A 2 ul sample size is recommended for protein measurements.

Special Cleaning Requirements for Proteins

Proteins and solutions containing surfactants are known to "un-condition" the measurement pedestal surfaces so that the liquid column does not form. If this occurs, "buff" the measurement pedestal surfaces by rubbing each with a dry laboratory wipe 15-20 times. This will "re-condition" the surface allowing for the liquid sample column to form.

Measurement Concentration Range

On the NanoDrop[®] ND-1000 Spectrophotometer, the regular BCA assay can measure samples from ~0.20 mg/ml up to 8.0 mg/ml. A mini-BCA assay covers an approximate range of 0.01 – 0.20 mg/ml.

Assay Type	Approx. Lower Limit	Approx. Upper Limit	Typical Reproducibility (minimum 5 replicates) (SD= mg/ml; CV= %)
Regular BCA	0.2 mg/ml	8.0 mg/ml	\pm 2% (over entire range)
Mini BCA	0.01 mg/ml	0.20 mg/ml	\pm 0.01 mg/ml (over entire range)

BCA Kits, Protocols, and Sample Preparation

Commercial BCA Protein kit manufacturers typically outline procedures for two different protein concentration ranges:

- <u>A regular assay using a 20:1 reagent / sample volume ratio</u>. To accurately prepare standards, we suggest using a minimum sample volume of 4 ul in 80 ul of BCA reagent (larger sample volume is preferable).
- <u>A mini assay using a 1:1 reagent / sample volume ratio</u>. To prepare sufficient volume of these 1:1 mixtures, we suggest using a minimum of 10 ul of sample and 10 ul of BCA reagent in a PCR tube. Using the same pipettor for both volumes will eliminate any pipette-to-pipette accuracy differences.

Note: If you run the assay at 60°C, doubling the volumes may afford greater insurance against skewed results from evaporation / condensation within the sealed reaction tube.

In addition to the kit reagents, protein standards (BSA) for generating a standard curve are provided for the BCA method by the manufacturer. Follow the manufacturer's protocol for the assay including recommended incubation times and temperature. Additionally, use the respective standard (e.g., BSA) and dilutions that cover the analytical range (mg/ml) of interest. Note: Since the ND-1000 can measure higher protein concentrations, you may need to supply your own protein standards at higher concentrations than provided by the manufacturer.

Unique Screen Features

View Standard Curve (F8): selecting this button allows the user to view the standard curve at any time.

Sample Type: choices are Reference, Standards 1-7, and Sample. The software will guide you to measure your reference, then at least one standard before allowing measurement of samples.

<u>Replicate #:</u> counter for tracking replicate number during reference and standard measurement.

Reset Window (F11): clears all replicates of all standards.

Reset This Std (F12): clears all replicates of the selected standard.

Absorbance at 562nm: the Cu-BCA complex's absorbance at 562 nm for the 1mm pathlength.

<u>Cursor λ and Absorbance</u>: this feature allows the user to adjust the cursor wavelength and view the corresponding absorbance. The cursor wavelength can be set by the user. Note: The user-selected wavelength and absorbance are not utilized in any calculations.


mg/ml: the concentration of the sample (unknown).

Show Report: formatted for 200 samples although the buffer size can be increased to accommodate thousands of samples.

Making BCA Measurements

A standard curve is required every time the BCA assay is run. <u>Although curves can be saved and reloaded in the NanoDrop[®] ND-1000</u> <u>Spectrophotometer software, it is recommended that the user follow manufacturers' guidelines and generate fresh standard curves for</u> <u>each assay</u>. Both single and multi-point standard curve generation is incorporated into the software. A standard curve can be developed using a reference (BCA reagent only – no protein) and a single replicate of one standard. The multi-point standard curve generator allows a maximum of five replicates for each of seven different standards. There is no set order in which standards must be run.


There are only three general procedural steps to unknown protein concentration measurements. The requisite order, including generating the standard curve, is as follows:

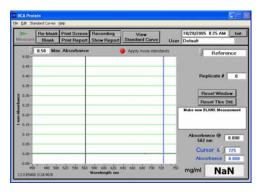

Step 1: Measure the 'Reference' (BCA reagent – a 'zero' Standard)

The software will not allow measurement of samples until at least 1 standard and references – or 2 standards – are measured.

Note: Software will guide the user with instructions in the large text box on the right side of the screen. The red light indicates the standard curve is incomplete and not yet ready for sample measurements.

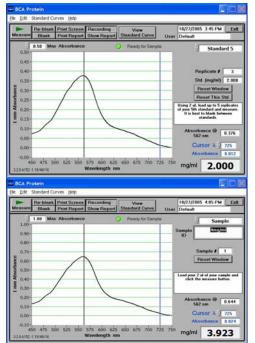

Step 2: Measure Standards

Up to 5 replicates of each standard can be measured. The software will not allow measurement of samples until a minimum of 1 standard and references – or 2 standards – are measured. Polynomial curve fitting requires more standard points depending on the polynomial degree selected.

Step 3: Measure Samples

Once a minimum standard curve has been established, the red indicator light will turn green, allowing the user to start measuring samples. Sample concentrations are calculated by using linear interpolation (point-topoint) between the two standards flanking the unknown sample or by using polynomial fitting. [Note: In order to obtain a concentration value (mg/ml) the sample (unknown) must fall within the limits of the standard curve].

Standard Curve Features

Standard curves can be saved and reloaded for reference use by using the 'Standard Curve' pull down menu and choosing save or reload functions. Selecting the 'View Standard Curve' button allows the user to review the standard curve at any time.

The Delete Point button allows the user to delete points by first selecting the data point to be deleted in the table and then choosing the 'Delete Point' button. If erroneous or non-representative readings are encountered for a specific standard, all replicates of that standard are cleared by selecting 'Reset this std'. Additionally, all standards can be deleted at once using the 'Reset This Window' (F11) button.

Experiment of the second o		Date	to Doict	1					User Default			
Regular BCA Standard Curve: Output Data Static Static Image: Static Static Static Static Image: Static S							labe 4	Table 6				
The second of	Balarence						7495.4	7498.9				
Regular BCA Standard Curve: Output: <	Standard 1	0.100	0.033	0.032	0.632	0.034			320A152	1.15/48/16		
Regular BCA Standard Curvers yes Protection of the Theory of theory of the theory of theory of the theory of th							-	-				
Regular BCA Standard Curves 0.2 – 8.0 mg/ml 0.2 – 8.0 mg/ml mini-BCA Standard Curves 0.01 – 0.20 mg/ml		1.000	0.215	0.215	0.275	0.214		-	Drint Dama	1.0		
Regular BCA Standard Curves 0.2 – 8.0 mg/ml			0.376						[Prim Page]		<u> </u>	
C2 - 8.0 mg/ml 0.2 - 8.0 mg/ml 0.2 - 8.0 mg/ml			0.909		0.905	0.942						
Contract Standard Curve: Standard Curve: 				Risque	sred 0	9990	Stand	ard Curve	e Type 🏐 Polynomia	l order 2	3	
solution of the second												0.2 - 0.0 mg/m
Contracting to the second of the second 												
Building of the second of 												
Based of Control 1995 Control 1995 Statistic Statistic							-					
Image: contrast std Contra						1						
Image: constraint of the state	4 0.40				-							
Diagonal				-								
Diagonalization Diagonaliz												
Construction Construction<			1.00									
Outer - Start Outer -	0.10											
Texture Texture <t< th=""><th>0.00</th><th></th><th></th><th>2.00</th><th>2.50</th><th>3.00 3</th><th></th><th></th><th>5.00 5.50 6.00 6.50</th><th>7,00 7.50</th><th>8.00</th><th></th></t<>	0.00			2.00	2.50	3.00 3			5.00 5.50 6.00 6.50	7,00 7.50	8.00	
Tetrament Composition	0.00- 0.00	in Std. (Gurve	2.00	2.50	3.00 3			5.00 5.50 6.00 6.50	7,00 7.50	8.00	
Termined 1 1	0.00- 0.00	in Std. (lext Help Dele	Surve te Point] ٨٥	sorban	De	mg/	ml		7,00 7.50	8.00	
Number Number East Number 100 000 <t< td=""><td>0.00- 0.00</td><td>in Std. (text Help Dete [regist</td><td>te Point</td><td>Ats. 1</td><td>sorbah</td><td>Als. 3</td><td>mg/</td><td>ml</td><td>User Default</td><td></td><td>8.00</td><td></td></t<>	0.00- 0.00	in Std. (text Help Dete [regist	te Point	Ats. 1	sorbah	Als. 3	mg/	ml	User Default		8.00	
Name of the state of	0.00- 0.00	in Std. (text Help Dete sg/si (4.000	te Point	Abs. 1 0.006	Als. 2	Abs. 3 0.005	mg/	ml	User Default 19/27/25	105 5 15	8.00	
Vanded & 0 100 0 101 0 100 0 100 0 100 Vanded & 0 100 0 100 0 100 0 100 0 100 0 100 Vanded & 0 100 0 100 0 100 0 100 0 100 0 100 0 100 Vanded & 0 100 0 100 0 100 0 100 0 100 0 100 0 100 Vanded & 0 100 0 100	0.00- 0.00	Dete	te Point Are Abs 0.008 0.025	Abs. 1 0.005 0.007 0.000	Als. 2 0.000 0.025	C40 Alter 3 0.005 0.025	mg/	ml	User Default 19/27/25	105 5 15	8.00	
Standard 7 District 2000 District 20	0.00- 0.00	Dele mylwi 0.000 0.000 0.000 0.000	te Point Are Ab. 0.005 0.000 0.025 0.000	Abs. 1 0.000 0.000 0.000 0.000	Als. 2 0.006 0.005 0.078	Als. 3 0.005 0.025 0.079	mg/	ml	User Default 19/27/25 3204152	IDS 5.15 1.13/40/16	2	
Progeneral 0.996 Blandard Curve Type Protycomial order 1 0.00 0.01 - 0.20 mg/ml	0.00- 0.00 Show Cont Reference Standard 1 Standard 1 Standard 3	n Std. (text Help Dete egisi 0.000 0.010 0.020 0.025	te Point Am Abs. 0.005 0.000 0.025 0.000 0.130	Abs. 1 0.005 0.007 0.000 0.000 0.000 0.130	Als. 2 0.006 0.025 0.075 0.170	Als. 3 4.005 0.009 0.025 0.079	mg/	ml	User Default 19/27/25 3204152	IDS 5.15 1.13/40/16	2	
0.01 – 0.20 mg/ml	0.00- 0.00 Show Cont Show Cont Standard 1 Standard 1 Standard 3 Standard 3 Standard 5	Dele m Std. (text Help Dele mg/m 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000	te Point Are Abs 0.005 0.000 0.030 0.030 0.154	Abs. 1 0.000 0.000 0.000 0.130 0.130 0.152	Als. 2 0.006 0.005 0.078 0.150 0.152	Abs. 3 0.005 0.025 0.079 0.129 0.158	mg/	ml	User Default 19/27/25 3204152	IDS 5.15 1.13/40/16	2	
0.33 0.33 0.33 0.35 0.30 0.01 – 0.20 mg/ml	0.00- 0.00 Show Cont Show Cont Standard 1 Standard 1 Standard 3 Standard 3 Standard 5	Dele m Std. (text Help Dele mg/m 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000	te Point Are Abs 0.005 0.000 0.030 0.030 0.154	Abs. 1 0.000 0.000 0.000 0.130 0.130 0.152	Als. 2 0.006 0.005 0.078 0.150 0.152	Abs. 3 0.005 0.025 0.079 0.129 0.158	mg/	ml	User Default 19/27/25 3204152	IDS 5.15 1.13/40/16	2	
	0.00 0.00 SCA Protein Show Cont Standard 1 Standard 3 Standard 3 Standard 5 Standard 5	Dele m Std. (text Help Dele mg/m 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000	te Point Are Ab. 0.005 0.000 0.500 0.594 0.594 0.549	Abs. 1 0.005 0.007 0.030 0.030 0.150 0.152 0.152 0.250	Allas 2 0.006 0.005 0.005 0.005 0.005 0.152 0.152 0.347	Abs. 3 4 00% 0 00% 0 02% 0 02% 0 12% 0 12% 0 15% 0 3%	mg/	Apr. 2	User Default 19/27/25 320415 Print Page	105 5:15 1:13/40/16 Ex	2	mini-BCA Standard Curve:
0.25	0.00 0.00 SCA Protein Show Cont Standard S Standard S Standard S Standard S Standard F Standard F Standard F	Dele m Std. (text Help Dele mg/m 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000	te Point Are Ab. 0.005 0.000 0.500 0.594 0.594 0.549	Abs. 1 0.005 0.007 0.030 0.030 0.150 0.152 0.152 0.250	Allas 2 0.006 0.005 0.005 0.005 0.005 0.152 0.152 0.347	Abs. 3 4 00% 0 00% 0 02% 0 02% 0 12% 0 12% 0 15% 0 3%	mg/	Apr. 2	User Default 19/27/25 320415 Print Page	105 5:15 1:13/40/16 Ex	2	
g 0.20	0.00 BCA Protein Show Cont Stonkerd 1 Standard 3 Standard 3 Standard 5 Standard 5 Standard 5 Standard 5	Dele m Std. (text Help Dele mg/m 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000	te Point Are Ab. 0.005 0.000 0.500 0.594 0.594 0.549	Abs. 1 0.005 0.007 0.030 0.030 0.150 0.152 0.152 0.250	Allas 2 0.006 0.005 0.005 0.005 0.005 0.152 0.152 0.347	Abs. 3 4 00% 0 00% 0 02% 0 02% 0 12% 0 12% 0 15% 0 3%	mg/	Apr. 2	User Default 19/27/25 320415 Print Page	105 5:15 1:13/40/16 Ex	2	
	0.00 0.00 ScA Proteining Show Cont Standard 1 Standard 2 Standard 2 Standard 3 Standard 4 Standard 4 Standard 5 Standard 5 Sta	Dele m Std. (text Help Dele mg/m 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000	te Point Are Ab. 0.005 0.000 0.500 0.594 0.594 0.549	Abs. 1 0.005 0.007 0.030 0.030 0.150 0.152 0.152 0.250	Allas 2 0.006 0.005 0.005 0.005 0.005 0.152 0.152 0.347	Abs. 3 4 00% 0 00% 0 02% 0 02% 0 12% 0 12% 0 15% 0 3%	mg/	Apr. 2	User Default 19/27/25 320415 Print Page	105 5:15 1:13/40/16 Ex	2	
	0.00	Dele m Std. (text Help Dele mg/m 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000	te Point Are Ab. 0.005 0.000 0.500 0.594 0.594 0.549	Abs. 1 0.005 0.007 0.030 0.030 0.150 0.152 0.152 0.250	Allas 2 0.006 0.005 0.005 0.005 0.005 0.152 0.152 0.347	Abs. 3 4 00% 0 00% 0 02% 0 02% 0 12% 0 12% 0 15% 0 3%	mg/	Apr. 2	User Default 19/27/25 320415 Print Page	105 5:15 1:13/40/16 Ex	2	
2 0.15	0.00- 0.00 SCA Protei Show Cont Show Cont Standard 2 Standard 2 Standard 3 Standard 5 Standard 5 Standard 7 0.40 0.35 0.35 0.35 0.20	Dele m Std. (text Help Dele mg/m 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000	te Point Are Ab. 0.005 0.000 0.500 0.594 0.594 0.549	Abs. 1 0.005 0.007 0.030 0.030 0.150 0.152 0.152 0.250	Allas 2 0.006 0.005 0.005 0.005 0.005 0.152 0.152 0.347	Abs. 3 4 00% 0 00% 0 02% 0 02% 0 12% 0 12% 0 15% 0 3%	mg/	Apr. 2	User Default 19/27/25 320415 Print Page	105 5:15 1:13/40/16 Ex	2	
0.10	0.00- 0.00 SCA Protei Show Cont Show Cont Standard 2 Standard 2 Standard 3 Standard 5 Standard 5 Standard 7 0.40 0.35 0.35 0.35 0.20	Dele m Std. (text Help Dele mg/m 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000	te Point Are Ab. 0.005 0.000 0.500 0.594 0.594 0.549	Abs. 1 0.005 0.007 0.030 0.030 0.150 0.152 0.152 0.250	Allas 2 0.006 0.005 0.005 0.005 0.005 0.152 0.152 0.347	Abs. 3 4 00% 0 00% 0 02% 0 02% 0 12% 0 12% 0 15% 0 3%	mg/	Apr. 2	User Default 19/27/25 320415 Print Page	105 5:15 1:13/40/16 Ex	2	
" 0.05-	0.00 BCA Proteining Show Control Show Control Standard 1 Standard 2 Standard 3 Standard 5 Standard 5 Standard 7 0.40 0.35 0.30 0.30 0.30 0.30 0.30 0.35 0.30 0.30 0.35 0.30 0.35	Dele m Std. (text Help Dele mg/m 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000	te Point Are Ab. 0.005 0.000 0.500 0.594 0.594 0.549	Ada 1 0.000 0.000 0.000 0.110 0.120 0.120 RF square	Allas 2 0.006 0.005 0.005 0.005 0.005 0.152 0.152 0.347	Abs. 3 4 00% 0 00% 0 02% 0 02% 0 12% 0 12% 0 15% 0 3%	mg/	Apr. 2	User Default 19/27/25 320415 Print Page	105 5:15 1:13/40/16 Ex	2	
0.00	0.00 SCA Protein Show Com Show Com Standard 2 Standard 2 Sta	Dele m Std. (text Help Dele mg/m 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000 0.000	te Point Are Ab. 0.005 0.000 0.500 0.594 0.594 0.549	Ada 1 0.000 0.000 0.000 0.110 0.120 0.120 RF square	Allas 2 0.006 0.005 0.005 0.005 0.005 0.152 0.152 0.347	Abs. 3 4 00% 0 00% 0 02% 0 02% 0 12% 0 12% 0 15% 0 3%	mg/	Apr. 2	User Default 19/27/25 320415 Print Page	105 5:15 1:13/40/16 Ex	2	

Exiting the BCA Module It is recommended that you process all of the unknowns to be assayed before exciting the BCA software module.

11. Protein Lowry

The Modified Lowry Protein Assay is an alternative method for determining protein concentration based on the widely used and cited Lowry procedure for protein quantitation. Like the BCA and Bradford Assays, the Modified Lowry Assay requires standard curve generation each time it is run, before unknown proteins can be measured. The Modified Lowry procedure involves reaction of protein with cupric sulfate in alkaline solution, resulting in formation of tetradentate copper-protein complexes. The Folin-Ciocalteu Reagent is effectively reduced in proportion to the chelated copper-complexes resulting in a water-soluble blue product that is measured at 650 nm and normalized at 405 nm. Pre-formulated reagents, utilized in the assay, are available in kit form from numerous manufacturers. Follow their recommendations when mixing the respective reagents at the time the assay is to be performed.

Sample Volume Requirements

Some proteins are hydrophobic and others hydrophilic giving rise to variable surface tension in the sample to be measured. Additionally the presence of surfactants or detergents in reagents, such as the Bradford reagent, can significantly alter surface tension. This occurrence can be overcome without affecting the sample's absorbance by using a larger sample volume. **A 2 ul sample size is recommended for protein measurements**.

Special Cleaning Requirements for Proteins

Proteins and solutions containing surfactants are known to "un-condition" the measurement pedestal surfaces so that the liquid column does not form. If this occurs, "buff" the measurement pedestal surfaces by rubbing each with a dry laboratory wipe 15-20 times. This will "re-condition" the surface allowing the liquid sample column to form.

Measurement Concentration Range

On the NanoDrop[®] ND-1000 Spectrophotometer, the Modified Lowry assay can run from ~0.20 mg/ml up to 8.0 mg/ml.

Assay Type	Approx. Lower Limit	Approx. Upper Limit	Typical Reproducibility (minimum 5 replicates) (CV= %)
Modified Lowry	0.2 mg/ml	4.0 mg/ml	\pm 2% (over entire range)

Modified Lowry Kits, Protocols, and Sample Preparation

Commercial Modified Lowry Protein kit manufacturers typically outline procedures for their assays.

Modified Lowry assay – using a 5:1 reagent / sample volume ratio.

- To accurately prepare Standards, we suggest using a minimum sample volume of 20 ul and 100ul of Modified Lowry reagent. Using the same pipettor for both volumes will eliminate any pipette-to-pipette accuracy differences.
- After the initial 10 minute room temperature (RT) incubation period, add 10 ul of the Folin –Ciocalteu reagent and incubate for 30 minutes at RT.

In addition to the kit reagents, protein standards (BSA) for generating a standard curve are also provided by the manufacturer for the Modified Lowry method. Follow the manufacturer's protocol for the assay including recommended incubation times and temperature. Additionally, use the respective standard (e.g., BSA) and dilutions that cover the analytical range (mg/ml) of interest. Note: Since the ND-1000 can measure higher protein concentrations, you may need to supply your own protein standards at higher concentrations than provided by the manufacturer.

Unique Screen Features

View Standard Curve (F8): selecting this button allows the user to view the Standard Curve at any time.

Sample Type: choices are Reference, Standards 1-5, and Sample. The software will guide you to measure your reference, then at least one standard before allowing measurement of samples.

<u>Replicate #:</u> counter for tracking replicate number during reference and standard measurement.

Reset Window (F11): clears all replicates of all standards.

Reset This Std (F12): clears all replicates of the selected standard.

Absorbance at 650nm: the Cu-complex's absorbance at 650 nm for the 1 mm pathlength.

<u>Cursor λ and Absorbance</u>: this feature allows the user to adjust the cursor wavelength and view the corresponding absorbance. The cursor wavelength can be set by the user. Note: the user-selected wavelength and absorbance are not utilized in any calculations.


mg/ml: the concentration of the sample (unknown).

Show Report: formatted for 200 samples although the buffer size can be increased to accommodate thousands of samples.

Making Lowry Measurements

A standard curve is required every time the Modified Lowry assay is run. <u>Although curves can be saved and reloaded in the NanoDrop[®]</u> <u>ND-1000 Spectrophotometer software, it is recommended that the user follow manufacturers' guidelines and generate fresh standard curves for each assay</u>. Both single and multi-point standard curve generation is incorporated into the software. A standard curve can be developed using a reference (Modified Lowry reagent only – no protein) and a single replicate of one standard. The multi-point standard curve generator allows a maximum of five replicates for each of seven different standards. There is no set order in which standards must be run.


There are only three general procedural steps to unknown protein concentration measurement. The requisite order, including generating the standard curve, is as follows:

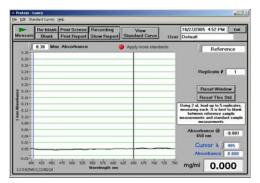

Step 1: Measure the 'Reference' (Lowry reagent – a 'zero' Standard)


The software will not allow measurement of samples until a minimum of 1 standard and Reference – or 2 Standards – are measured.

Note: Software will guide the user with instructions in the large text box on the right side of the screen. The red light indicates the standard curve is incomplete and not yet ready for sample measurements.

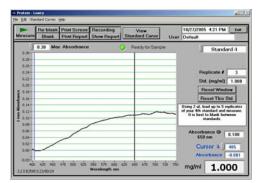

Step 2: Measure Standards

Up to 5 replicates of each standard can be measured. The software will not allow measurement of samples until a minimum of 1 standard and references – or 2 standards – are measured. Polynomial curve fitting requires more standard points depending on the polynomial degree selected.

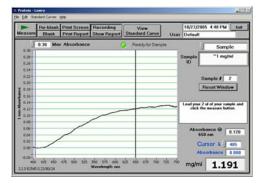


Step 3: Measure Samples

Once a minimum standard curve has been established, the red indicator light will turn green, allowing the user to start measuring samples. Sample concentrations are calculated by using linear interpolation (point-topoint) between the two standards flanking the unknown sample or by using polynomial fitting. [Note: In order to obtain a concentration value (mg/ml), the sample (unknown) must fall within the limits of the standard curve.]

Standard Curve Features

Standard curves can be saved and reloaded for reference use by using the 'Standard Curve' pull down menu and choosing save or reload functions. Selecting the 'View Standard Curve' button allows the user to review the standard curve at any time.

The Delete Point button allows the user to delete points by first selecting the data point to be deleted in the table and then choosing the 'Delete Point' button. If erroneous or non-representative readings are encountered for a specific standard, all replicates of that standard are cleared by selecting 'Reset this std'. Additionally, all standards can be deleted at once using the 'Reset This Window' (F11) button.

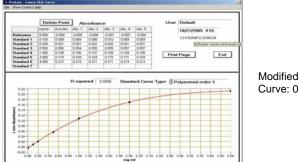

Modified Lowry Standard Curve: 0.2 – 4.0 mg/ml

Exiting the Lowry Module It is recommended that you process all of the unknowns before exciting the Lowry software module.

12. Protein Bradford

The Bradford Assay is a second alternative method commonly utilized for determining protein concentration. It is often used for more dilute protein solutions where lower detection sensitivity is needed and/or in the presence of components that also have significant UV (280 nm) absorbance. Like the BCA method, the Bradford method requires a standard curve to be generated each time the assay is run, before unknown proteins can be measured.

The Bradford uses the protein-induced Absorbance shift of Coomassie Blue dye to 595 nm as a measure of protein concentration. The bound protein-dye complex is measured at 595 nm and normalized at 750 nm. A single stabilized reagent mixture containing Coomassie Blue dye, alcohol, and surfactant in kit form is available from numerous manufacturers. Follow the respective manufacturer's recommendations for all standards and samples (unknowns), ensuring they are subjected to the identical conditions and timing throughout the assay.

Sample Volume Requirement

Some proteins are hydrophobic and others hydrophilic giving rise to variable surface tension in the sample to be measured. Additionally the presence of surfactants or detergents in reagents, such as the Bradford reagent, can significantly alter surface tension. This occurrence can be overcome without affecting the sample's absorbance by using a larger sample volume. **A 2 ul sample size is recommended for protein measurements**.

Special Cleaning Requirements for Proteins

Proteins and solutions containing surfactants are known to "un-condition" the measurement pedestal surfaces so that the liquid column does not form. If this occurs, "buff" the measurement pedestal surfaces by rubbing each with a dry laboratory wipe 15-20 times. This will "re-condition" the surface allowing for the liquid sample column to form.

Measurement Concentration Range

On the NanoDrop[®] ND-1000 Spectrophotometer using the regular Bradford assay, unknown protein concentrations from ~100ug/ml up to several thousand micrograms/ml (ug/ml) can be determined. The best linearity is in the 100-1000 ug/ml range. A mini-Bradford assay covers the approximate range of 15-125 ug/ml.

Coomassie dye-dye and Coomassie dye-protein aggregates are frequently encountered in Coomassie dye-based protein assays. With time, particulate can be observed, which can cause significant fluctuations in Absorbance readings. It is also important to note the total analyte (protein-dye) signal at 595nm is limited to ~ 0.150 A as a result of the 1.0mm pathlength of the instrument, the Bradford (Coomassie dye) reagent concentration, and the acidic pH. Making measurements in triplicate of standards and samples (unknowns) is good practice, particularly with the limited assay signal obtained with the Bradford Assay.

Assay Type	Approx. Lower Limit	Approx. Upper Limit	Typical Reproducibility (minimum 5 replicates) (SD= ug/ml; CV= %)
Regular Bradford	100 ug/ml	8000 ug/ml	sample range 100-500 ug/ml: \pm 25 ug/ml sample range 500-8000 ug/ml: \pm 5%
Mini Bradford	15 ug/ml	100 ug/ml	sample range 15-50 ug/ml: ± 4 ug/ml sample range 50-125 ug/ml: ± 5%

Bradford Kits, Protocols, and Sample Preparation

Commercial Bradford Protein kit manufacturers typically outline procedures for two different concentration ranges:

- <u>A regular assay using a 50:1 reagent / sample volume ratio</u>. To accurately prepare standards, we suggest using a minimum sample volume of 4 ul in 200 ul of Bradford reagent (larger sample volume is preferable).
- <u>A mini assay- using a 1:1 reagent / sample volume ratio</u>. To prepare sufficient volume of these 1:1 mixtures, we suggest using a minimum of 10 ul of sample and 10 ul of Bradford reagent in a PCR tube. Using the same pipettor for both volumes will eliminate any pipette-to-pipette accuracy differences.

In addition to the kit reagents, protein standards (e.g., BSA) for generating a standard curve are provided by the manufacturer. Follow the manufacturer's recommendation using standard (BSA) dilutions that cover the analytical (ug/ml) range of interest. Note: Since the ND-1000 Spectrophotometer can measure higher protein concentrations, you may need to supply your own protein standards at higher concentrations than provided by the manufacturer.

Unique Screen Features

View Standard Curve (F8): selecting this button allows the user to view the standard curve at any time.

Sample Type: choices are Reference, Standards 1-5, and Sample. The software will guide you to measure your reference, then at least one standard before allowing measurement of samples.

<u>Replicate #:</u> counter for tracking replicate number during reference and standard measurement.

Reset Window (F11): clears all replicates of all standards.

Reset This Std (F12): clears all replicates of the selected standard.

Absorbance at 595nm: protein-dye complex's absorbance at 595 nm at the 1mm pathlength.

<u>Cursor λ and Absorbance</u>: this feature allows the user to adjust the cursor wavelength and view the corresponding absorbance. The cursor wavelength can be set by the user. Note: The user-selected wavelength and absorbance are not utilized in any calculations.


ug/ml: concentration of the sample (unknown).

Show Report: formatted for 200 samples although the buffer size can be increased to accommodate thousands of samples.

Making Bradford Protein Measurements

A standard curve is required every time the Bradford assay is run. <u>Although curves can be saved and reloaded in the NanoDrop® ND-1000 Spectrophotometer software, it is recommended that the user follow manufacturers' guidelines and generate fresh standard curves for each assay. Both single and multi-point standard curve generation is incorporated into the software. A standard curve can be developed using a reference (Modified Lowry reagent only – no protein) and a single replicate of one standard. The multi-point standard curve generator allows a maximum of five replicates for each of seven different standards. There is no set order in which standards must be run.</u>

There are only three general procedural steps to unknown protein concentration measurement. The requisite order, including generating the standard curve, is as follows:

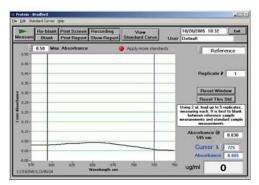

Step 1: Measure the 'Reference' (Bradford reagent – a 'zero' Standard)


The software will not allow measurement of samples until at least 1 standard and reference – or 2 standards – are measured.

<u>Note:</u> software will guide the user with instructions in the large text box on the right side of the screen. The red light indicates the standard curve is incomplete and not yet ready for sample measurements.



Cursor & 725 Absorbance 0.02 ml 2000 Step 2: Measure Standards

Up to 5 replicates of each standard can be measured. The software will not allow measurement of samples until a minimum of 1 standard and references – or 2 standards – are measured. Polynomial curve fitting requires more standard points depending on the polynomial degree selected.

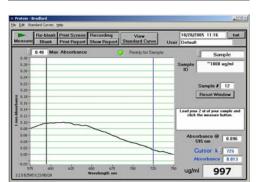


Step 3: Measure Sample

Once a minimum standard curve has been established, the **red** indicator light will turn **green**, allowing the user to start measuring samples. Sample concentrations are calculated by using linear interpolation (point-to-point) between the two standards flanking the unknown sample or by using polynomial fitting of the data. [Note: In order to obtain a concentration value (ug/ml) the sample (unknown) must fall within the limits of the standard curve.

Standard Curve Features

Standard curves can be saved and reloaded for reference use by using the 'Standard Curve' pull down menu and choosing save or reload functions. Selecting the 'View Standard Curve' button allows the user to review the standard curve at any time.

The Delete Point button allows the user to delete points by first selecting the data point to be deleted in the table and then choosing the 'Delete Point' button. If erroneous or non-representative readings are encountered for a specific standard, all replicates of that standard are cleared by selecting 'Reset this std'. Additionally, all standards can be deleted at once using the 'Reset This Window' (F11) button.

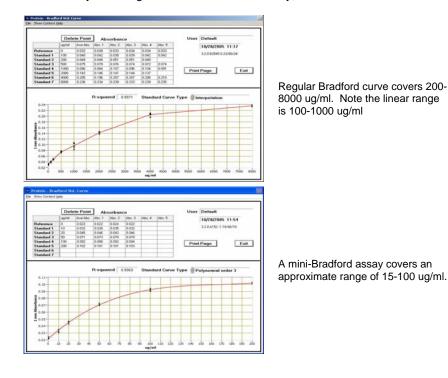

Exiting the Bradford Module

It is recommended that you process all of the unknowns to be assayed before exciting the Bradford software module.

13. Cell Cultures

Using an absorbance spectrophotometer to monitor light scattered by non-absorbing suspended cells is common practice in life science laboratories. Such applications, more than any other, accentuate the differences amongst the optical systems of the numerous spectrophotometer designs.

Note: The most distinct difference between the NanoDrop[®] ND-1000 spectrophotometer "absorbance" values for cell microbial cultures and those observed using classical cuvette based systems will be attributable to the shorter pathlength (1 mm vs. 1 cm.) Values may not be exactly 10 fold different as readings are dependent on both the optics of a specific spectrophotometer as well as the cell type in suspension.

The 'Cell Cultures' module displays the sample spectrum from 250 nm to 700 nm. One cursor is fixed at the frequently used wavelength for monitoring cell suspensions (600nm) while the second cursor can be set to the wavelength of interest.


Sample Size Requirements

Field experience has indicated that 1ul samples are sufficient to ensure accurate and reproducible results when measuring aqueous samples. However, if you are unsure about your sample composition or your pipettor accuracy, a 2 ul sample is recommended to ensure that the liquid sample column is formed and the light path completely covered by sample.

Cell Suspension Concentrations

Due to its shorter pathlength, the ND-1000 can measure absorbencies that are 10-fold higher than those measurable on a standard cuvette spectrophotometer. This makes it possible to directly monitor concentrated cell suspensions. Since the entire spectrum is displayed, diluted samples exhibiting very low 'Absorbance' at 600 nm can be monitored at lower wavelengths, for example 280 nm.

Unique Screen Features

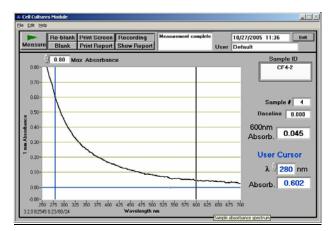

<u>600nm Absorbance</u>: current value of the absorbance at the $\lambda 1$ cursor with the Baseline absorbance subtracted. Note: the actual 1 mm absorbance is displayed.

<u>\lambda</u> and Absorb.: current value of the user-selectable wavelength cursor and corresponding absorbance. The wavelength can be set by dragging the cursor, using the up/down arrows or typing in the desired wavelength. Note: The user-selected wavelength and absorbance are not utilized in any calculations.

Baseline: the absorbance of the user selectable-baseline (horizontal) cursor. The user may drag this cursor to a new vertical position to create a new baseline. The absorbance value of the baseline is subtracted from the absorbance of the spectrum.

Max Absorbance: used to rescale the upper limit of the vertical axis.

Show Report: formatted for 200 samples although the buffer size can be increased to accommodate thousands of samples.

Sample Homogeneity

The user must be sure to homogeneously suspend the cells when sampling for "absorbance" measurements and read the sample immediately to avoid significant cell settling. Vigorous mixing may be required particularly when measuring concentrated samples

Decontamination of Measurement Pedestals

If decontamination is necessary, a 5.25% solution of sodium hypochlorite (bleach – freshly prepared) or other decontaminating solutions can be used to ensure that no biologically active material is present on the measurement pedestals. The metal fiber optic fittings are made from 303 stainless steel and are very resistant to most common laboratory solvents (see "Solvent Compatibility" appendix.)

14. Archived Data and Data Viewer

Sample data from all application modules is automatically stored in archive files and can be opened by either the integrated Data Viewer software program or spreadsheet programs such as MS Excel.

Archive File Creation

Every time an application module is started, an application-specific archive file is created for the user that is logged in. All measurements made by the user (in that application module) for a given calendar day are stored in a single archive file. These files bear the name of the respective application module with the date appended. For example, an archived file entitled "Nucleic Acid 2005 11 07.ndj" corresponds to Nucleic Acid data from the software session that began on November 7, 2005. A unique file extension (.ndj) has been given to these files to enable automatic startup with the Data Viewer (see section on Data Viewer below).

The data may be edited and/or reformatted and stored under names of the user's choice. The spectrum can be re-plotted from the wavelength data if needed for further analysis.

Note1: Absorbance data shown in archive files are represented as they are displayed on the screen. For Nucleic Acids, Protein A280, and Protein and Labels application modules, data are stored based on a 1.0 cm (10.0 mm) path. For MicroArray, UV-Vis, BCA Protein, Bradford, Lowry and Cell Culture application modules the data is normalized to a 1.0 mm (0.1 cm) path. For high absorbance UV-Vis samples, data are stored based on a 0.1 mm path.

Note 2: For data from all modules, a column entitled 'Measurement Type' is included. For each measurement, this column will contain 'Measure', 'Blank', or 'Reblank'. If the value is 'Measure', then the values in that row are from a normal measurement that has utilized the stored blank value. If the value is 'Blank', it indicates that the measurement is the initial blank recorded. If the value is 'Reblank', it is the re-analysis of the previous measurement with a new blank.


E 1	Aicrosoft E	xcel - Nuc	leic Acid 20	005 11	01 v3.2.n	dj [Read G	Only]							
: 🕑	Ele Edit	⊻iew Ins	sert Format	Icols [ata <u>W</u> indo	W ACTI	Help Adobe	PDF					Туре а	question for h
: 🗅	😂 🖬 🗧) 🖪 🖪	1 🕰 1 🗈 🕯	3-1-0-	😣 Σ -	21 💷 🛛	0 📲 🖬	Arial	- 1	0 - B	ΙU		B %	, 🖽 -
1	1 21 21 2	a 👒 🖄 I	5012	1 🗞 😰 I	₩V Reply wit	h ⊆hanges	End Review.							
1	12 🖏 👷													
	A1		s Module:											
	A	B	Formul	a Bar D	E	F	G	H	1	J	K	L	M	N
1	Module:	Nucleic Ar	cid											
2	Path:	10 mm												
3	Software:	3.2.0												
4	Firmware:	USB2000	2.41.3 ND3											
5	Sample ID	User ID	Date	Time	ng/ul	A260	A280	260/280	260/230	Constant	Cursor Po	Cursor ab:	340 raw	Measurem
6		Default	11/1/2005	8:38 AM	0	0	0	NaN	NaN	50	230	0	0	Blank
7		Default	11/1/2005	8:39 AM	3.51	0.07	0.03	2.42	2.12	50	230	0.033	0	Measure
8		Default	11/1/2005	8:39 AM	43.76	0.88	0.52	1.67	2.43	50	230	0.36	0.008	Measure
8 9 10		Default	11/1/2005	8:40 AM	393.73	7.87	4.27	1.85	2.35	50	230	3.353	0.008	Measure
10		Default	11/1/2005	8:41 AM	3704.14	74.08	39.84	1.86	2.24	50	230	33.075	-0.038	Measure

Data Storage Hierarchy

The hierarchy for archive files is as follows:

*C:*WanoDrop Data → User name → Application Module (BCA Protein, Lowry, Bradford, Cell Culture, MicroArray, Nucleic Acid, Protein A-280, Proteins & Labels, UV-Vis or UV-Vis HiAbs)

All archived data files are stored within an application module folder that is within the User folder as shown below:

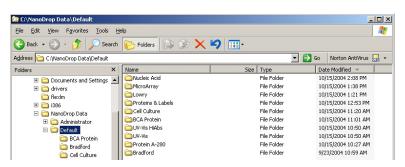

User-Defined Archive File Location

In addition to the primary data storage, users may elect to save their data to an additional location. This option can be chosen under the Archiving Tab in User Preferences on the Main Menu by setting the 'Duplicate data storage box' to 'On' and then choosing the file path by clicking on the file folder icon under Duplicate Data Folder. Save the alternative path by clicking on the 'Save Preferences' button before exiting the User Preferences window.

All data are written to the archive file immediately upon completion of the measurement. Inadvertent software or PC shutdowns should not affect the archive file.

Data Viewer

Data Viewer is a versatile data reporting software program incorporated into the NanoDrop software that offers the user the ability to customize report structures, import stored data and re-plot data generated from NanoDrop instruments. Using the Data Viewer is the most expedient method to review data. This feature may be accessed during measurement sessions from the Show Report function found within each method module. It may also be accessed from the Main Menu page. An ND-1000 Spectrophotometer does not need to be connected to the PC to use the Data Viewer module.

Data Viewer Features

The Data Viewer is composed of two or three pages in a tabular form consisting of Plots, Reports and Standard Curves (where utilized). The user may access any page by clicking on the tabs.


The software opens to the Report page (see Plots section below) whether accessed through the Main Menu or Show Report. Note: Recording rather than Start Report must be selected in order to access the Data Viewer via Show Report.

Tool Bar Features common to all three pages include:

- Configuration: Options controlled by this tool bar function include 'Auto Scale', 'Include graph in printout' and 'Include standards in printout'.
- Data: Includes options to import data, rename samples and delete sample data. Note: After deleting all samples, it is important to exit out of the Data Viewer module and re-enter if importing data for a different application type.
- Report: This tool bar function allows the user to select columns of interest to be included in a report. See section on Reports
 Page for more detail.
- File Page Set-up: Allows the user to define the page set up for printing out the spectra, the report and the standard curve.
- Print Window: The current Plot, Report, or Standards screen may be printed by selecting 'Print Window' or 'CTL +P'.
- Save Window: Saves files as .JPGs.
- Help/Context Help: This feature is enabled in the Main Menu, all function modules, and the application modules. The help
 feature is enabled by choosing 'Show Context Help' from the Help menu pull down or by selecting 'Ctrl H'. Once enabled,
 placing the cursor on elements of the screen will automatically generate an explanation of that element. Context Help remains
 active until deselected.

Import


To import samples for viewing, select "Import Samples" from the "Data" menu of either the Plots or Report pages within the Data Viewer software. This will bring up a new window with an Import Folder box and a Directory Tree as shown below.

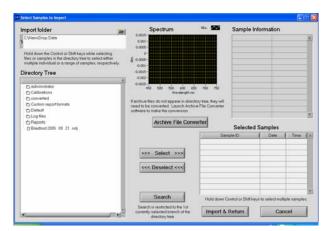

Features include:


- Import folder: Used to select folder where data is to be imported from. Folder selection must be at the level of user or highermay not select an application or method folder within a user in this activity box.
- <u>Directory tree:</u> Used to select specific data to be imported. Clicking on the square to the left of each file name will provide further detail to each level. Users may choose to select either individual samples within a file or the entire file. All import selections must be of the same application or method type. Note: Hi Abs data cannot be imported into the Data Viewer but can be opened with Excel type spreadsheets.
- <u>Archive File Converter:</u> ND-1000 data generated with earlier versions of NanoDrop software and not stored in c:\nanodrop data will need to be copied and converted to 3.2 version compatible .ndj files. Refer to the Archive File Converter section below for more details. Note: The original archive files will not be altered during this process.

- >>> or <<<: Used to move the highlighted sample choices to or from the Selected Samples box. Note: The software defaults to a buffer size of 200 samples.
- <u>Search</u>: Function allows the user to locate specific data by searching through sample ID names.
- Sample Information and Spectrum: Are populated with the information associated with the most recently highlighted sample.
- Import and Return: Uses selected sample data to populate Plots and Reports windows. Note: Holding down the shift or control
 PC function keys will allow the user to select multiple samples and/or files for importing. The keys can also be used to deselect
 multiple samples. See example below:

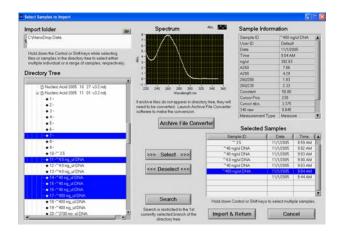

Plots

The Plots page is where selected sample spectra are displayed.

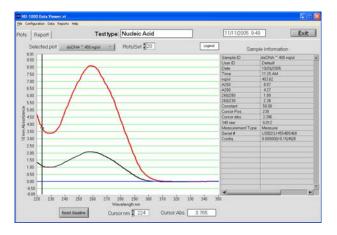

Features include:

- <u>Method:</u> Auto fills in module name.
- <u>Date:</u> Auto fills in date and time of report.
- <u>Selected Plot:</u> There are two methods of selecting or highlighting individual sample data. The user may simply move the cursor over the plot of interest and click or use the 'Selected Plot' drop down box (which will also display the legend). The selected sample will show up as a bold plot line.
- <u>Plots/Sets:</u> Users may select the maximum number of individual plots (up to 20) graphed per page. Since a report can hold data for many samples and a graph page is limited to 20 plots, additional sample spectra are displayed on new pages. Each page is then referred to as a set.
- Legend: Positioning the cursor over the legend box will bring up a visual display matching the sample name to a plot color. The user is not able to select or highlight a sample from the legend.
- <u>Sample information</u>: Automatically populates with data associated with selected sample. Data displayed is appropriate for data type chosen. Note: Information is based on data collected at the time the sample was measured and is not modified by a change in cursor position on the Data Viewer real time display.
- <u>Movable x and y axis</u>: Available for all data types. If the cursor is out of view in either direction- rescale the axis by typing over one of the outer limit numbers. The cursor absorbance information displayed at the bottom of the page is determined by the position of the movable cursors. The movable X determines the baseline from which the peak of the Y position is calculated. Reset Baseline will reposition the x axis back to zero.

Reports

The Reports page displays the data for selected samples in a table format. The user may modify column configurations for each method type and save multiple customized formats.

Report	Т	est type: No	cleic Acid	1			1	0/27/2005	5 1:10	E	cit
rt Name 10/27/06	sample data] м	ax Buffer	Size	200	Buffer M	lode 🔡	iave Repor	t & Clear	-
Semple	User	Dete	Time	ngM	A250	A280	260/280	265/230	Constant	Cursor Pos	Curso
dsONA 7 400 ng/sl	Defoult	10/26/2005	11:25 AM	403.62	8.97	4.27	1.89	2.38	-56.00	230	3.396
dsDNA	Default	10/26/2005	11.29 AM	233.66	4,67	2.47	1.89	2.35	50.00	230	1.987
deDNA	Default	10/26/2005	11:29 AM	161.44	323	1.74	1.86	2.33	58.00	230	1.386

Some key options useful for the Reports page are accessible through the Report tool bar drop down.

Choosing the 'Configure Report' option brings up the following box:

Report configuration editor				
Select the report columns to display and the order that the columns should appear. Change the order by selecting and dragging a column header string to the desired position,				
Report columns				
Sample ID				
User ID Date Time	Show All			
ng/ul A260 A280	Move Up			
260/280 260/280	Move Down			
Constant Cursor Pos. Cursor abs.	Delete			
340 raw				
ок с	ancel			

Selecting 'OK' will return the user to the reports page displaying only the columns of interest.

Features include:

- Sort: Allows users to sort data by column (example-by date or sample name) and by either ascending or descending order.
- <u>Save Report Format</u>: Saves the current report format as an .ndf file for retrieval and future use. To designate a saved report format as the default format, exit to the Main Menu, choose 'Users Preferences' and click 'Reports'. Use the "Select Default Report Format' to see the list of saved formats available for the specific method type.
- Load Report Format: Allows saved report formats to be loaded either before or after data is imported.
- Print report: Will print out only the Report page by default. Users may choose whether or not to print out the standards or plots
 pages by selecting these options under the Configuration drop down on the tool bar.
- Save Report and Load Report: There are several options for this feature as seen in the following window:

E Save Report As		
Choose how to sa	we the report:	
Full Report	Choose this option to be able to reload the report into the Data Viewer at a later date.	
Export Report Table Only	Choose this option to export a tab deliminited text file of the displayed Report Table suitable for import into Excel.	
Export Report & Standards Tables	Choose this option to export a tab deliminited text file of the displayed Report & Standards Tables suitable for import into Excel.	
Cancel		

Using the Full Report option will allow the user to use the Data Viewer to reload the report at a later date. The saved report may be recalled using the pull down Load Report. If using the Load Report feature- the report will be displayed with the default column configuration. Note: Access the User Preferences module on the main menu to modify and save preferred default configurations. Reports are saved in an .ndv format.

The other two options are meant for reports that are expected to be opened in Excel type spreadsheets. To open these reports, go to the *C:WanoDrop Data* Reports folder and right click on the file of interest.

Additional features of the Report page:

- Method: Automatically populated with data method type.
- Date and time: Automatically populated when report is generated.
- **Report Name:** User defined designation for the current report.
- Buffer mode: Drop down box defining options for managing reports.
- Max Buffer size: Default number is set at 200. When the selected buffer size is reached, the Report will either be 'Saved & Cleared' or 'Printed and Cleared'.

Standards Page

.

The Standards page will display the actual reference standards applied to each particular sample at the time of measurement. Note: This page is available for software modules utilizing a Standard Curve.

Plots Report Standards	Testt	ype: Br	adford					10/27,	/2005 1	:17
Standards										
Sample ID	Curve Type	Ref conc	Ref Abs	Std 1 conc	Std 1 Abs.	Std 2 conc	Std 2 Abs	Std 3 conc	Std 3 Abs	Std «
Reference	Interp	0.00	0.029	NaN	NaN	NaN	NaN	NaN	NaN	NaN
Standard 1	Interp	0.00	0.029	100.00	0.047	NaN	NaN	NaN	NaN	Nañ
Standard 2	Interp	0.00	0.029	100.00	0.047	1000.00	0.099	NaN	NaN	Nal
Standard 3	Interp	0.00	0.029	100.00	0.047	1000.00	0.108	2000.00	0.073	Nat

Archive File Converter

All archive files located in the c:\Nanodrop Data folder generated with earlier versions of NanoDrop software will automatically be copied and converted to 3.3 version-compatible .ndj files upon first use of the software. Archive files generated with earlier versions of software and not stored in the folder c:\NanoDrop Data will need to be converted manually before reviewing with the Data Viewer. The File Converter can be accessed from the Import Data page and the conversion can be done one file at a time or by converting an entire file folder. Note: The original archive files are not altered during this process.

≖ ND-1000 File Converter 3.2.0	\times
This utility program converts ND-1000 archive files created with a previous version the operating software to the current version 3.2 data format. New files are created the same folder as the source files. The original files are left unchanged. Select individual file to convert	
S Convert File	
Select folder to convert	
2 Convert Folder	
Include all subfolders?	
Exit	

Opening Archived Data with Spreadsheet Programs The archived files are in tab-delimited format and can be opened in Microsoft Excel or an equivalent spreadsheet program.

15. Troubleshooting

Error USB2000




This error might appear upon software startup and usually indicates that the USB cable is not properly connected or the software is not loaded properly. To troubleshoot, do the following:

- 1. Confirm that the USB cable is connected to both the PC and the instrument.
- 2. If the cable is connected properly but the error persists, run the 'USB Reset' application located in Start \rightarrow Programs \rightarrow NanoDrop → Utilities → USB Reset. (If USB Reset is not installed on your PC, you can download it from the 'Downloads' section of www.nanodrop.com).
- 3. Follow the onscreen instructions from USB Reset. After unplugging and then reconnecting the USB cable, the Found New Hardware Wizard should start as shown below. (Windows XP SP2 operating system will ask to allow it to search the internet for the proper software as shown- Select 'No, not this time'). Follow the prompts for automatic installation of the software.



- 4. Try the NanoDrop software, if it works properly you are finished. If it does not operate properly, go to step 5.
- 5. Shutdown the NanoDrop software and open the USBView utility to confirm proper USB communication: Start → Programs → NanoDrop -> Utilities -> USBView. If USBView is not installed on your PC, you can download it from the 'Downloads' section of www.nanodrop.com.
- 6. Click on the 'Device Connected' as shown below. If more than one USB device is connected, view each of them. One of the connected devices should give an "idVendor" and "idProduct" as 0x2457 and 0x1002 respectively as shown below. If these are present, the USB function of the instrument should be OK. If the "idVendor" and "idProduct" are different than below, or if no USB device is present in the list, go to step 7.

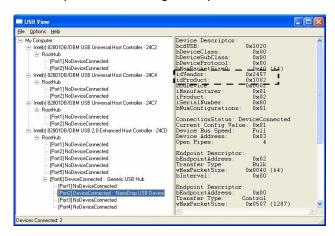

7. Install the instrument on another PC to rule out a faulty USB hub/port on the original PC. Run USBVIEW on the 2nd PC. If the same behavior is exhibited, then the instrument may need service. Contact NanoDrop Technologies or your distributor if this occurs.

Connection Error



This error occurs whenever the USB connection is disrupted while operating a software module. In most cases, selecting 'Retry' will reconnect properly. Some possible causes and solutions are listed below:

Power management scheme on the PC:

If your PC is automatically going into standby or hibernate mode, the USB communication will be lost whenever it occurs and 'Retry' will NOT reconnect the instrument. If this occurs, the USB cable will need to be disconnected/reconnected before selecting 'Retry'.

You can confirm that the power management settings are correct by opening the Power Options Properties page by choosing *Start* \rightarrow *Control Panel* \rightarrow *Power Options*. The 'System Standby' and 'System Hibernate' should be set to 'never' for the 'Plugged In' column as shown below.

Power Options Properti	25	<u>? ×</u>				
Power Schemes Alarms	Power Meter Adva	anced Hibernate				
Select the power scheme with the most appropriate settings for this computer. Note that changing the settings below will modify the selected scheme.						
Power schemes						
Home/Office Desk		•				
	Sav	ve As Delete				
- Settings for Home/Off	Settings for Home/Office Desk power scheme					
When computer is:	Plugged in	Bunning on batteries				
Turn off monitor:	After 20 mins	After 15 mins 💌				
Turn off hard disks:	Never	After 10 mins 💌				
System standby:	Never	After 30 mins 💌				
System <u>h</u> ibernates:	Never	After 45 mins 💌				
	ΟΚ	Cancel Apply				

Static Electricity Discharge

Discharge from the user to the instrument can be a problem in very dry environments. It may be necessary for the user to wear a grounding strap to prevent the discharges from occurring.

Defective USB Port on PC

If your instrument operates properly most of the time, but the Connection Error appears intermittently, it could be caused by the USB port on the PC. If this occurs, install the software and operate on another PC. If the error does not occur on the second PC, it may be necessary to replace the USB card on the original PC.

Signal Error

* Sample surf * Sample arm	kely caused by: ace is dirty - make sure - make sure sample a instrument - check 12∨	rm is in down positior
	ils, refer to the "Troubl nual (available from M	
	Retry At	port

This error occurs because no light or not enough light is reaching the detector. If the troubleshooting steps outlined in the message do not fix the problem, perform an Intensity Check:

• Open the Utilities and Diagnostics module from the main menu.

• With the sampling arm down, select OK to initialize the spectrometer and then select 'Intensity Check'. You should see a red and black spectrum and a bias value greater than 65 as shown below. This indicates that the USB communication is normal, the power supply is operational and the flashlamp is functioning.

Intensity Check	Detector Bas	Exit
4000.0 -	11 19	
2000.0- 2000.0- 2500.0-	MM	
B2000.0-	multin	W
100- 230.0 300 300 4	añas sáce sáce sáce sác	esis nis nis
rial Namber	Wavelength ren Configuration	
JSB2G1212 B1154		1/64/74

 If no spectra appear in the image, confirm that the power supply is firmly connected to the instrument and the plug is connected to a working outlet. Next, confirm that the power supply is operating properly. To do this, connect the leads of a volt-ohmmeter to the outlet of the supply. The voltage should be 12-20 Vdc, center positive.

If none of the troubleshooting steps above solve the problem, refer to the Technical Service section for getting help from your distributor or NanoDrop Technologies.

Saturated Detector

Ξ 🛛
The detector is saturated. This is most likely caused by initialization with dirty measurement pedestals. If the error persists: clean the pedestals, exit the software, and restart.
ОК

This error message can occur when the software calculates too high integration times during initialization. This is most likely due to a dried sample left on the measurement surface after the last use of the instrument. Cleaning both the top and bottom pedestals with deionized water and exiting out of the software module to the main menu should alleviate the problem. It is not necessary to close the software completely as each module is re-initialized when it is opened. If the error persists, contact NanoDrop Technologies or your local distributor.

Liquid Column Breakage

Warning		
	en the long path and short path al his might be caused by:	bsorbance is out
again. 2. The liquid co If this is occurri water and then dry lab wipe. If size (1.5 - 2 ul). 3. One or both If this warning p	was entrained in the sample. Try umn is not forming (can be confirm g, try (deaning both measurement wijnig each surface 50 times (agg column breakage persisits, use a l of the measurement paths is out o resists and the above remedies d t NanoDrop Technologies or your	ned visually). pedestals with ressively) with a larger sample of calibration. o not solve the
	OPEN USERS MAN	JUAL
1	ОК	

This warning occurs when a possible problem with the column is detected. The software compares the long path and short path absorbances and issues a warning to the user if the short path is not 20% of the long path absorbance, within a tolerance. The most common explanation is that the column is not forming properly due to the pedestal being "unconditioned".

Proteins and solutions containing surfactants are known to "un-condition" the measurement pedestal surfaces so that the liquid column does not form. "Re-condition the pedestal as follows:

- Apply 5-10 ul of ~0.5M of HCl to the bottom pedestal, lower the upper pedestal into the solution and let it sit for approximately 2 to 3 minutes. Wipe both pedestals with a clean lab wipe and repeat this using 5-10 ul of deionized water to wash away any residue.
- Fold a clean dry lab wipe over several times to increase its thickness. Press the lab wipe firmly down on the lower pedestal and "buff/rub" very aggressively at least 50 times the lab wipe will rip during this procedure and will have to be refolded several times throughout the procedure. The upper pedestal may also be buffed but care should be taken not to put too much force on the upper arm.
- Test the effectiveness of the re-conditioning by pipetting a 1-2ul sample of water onto the lower measurement pedestal and making sure the water "beads up" on the pedestal surface.

If the warning persists and the user visually confirms that the liquid column is forming, contact NanoDrop Technologies or your local distributor.

Error: Code 8

Error Code: 8		
Error reading or writing to file. This might be caused by:		
 The current Windows account does not have Read and Write priveleges to the folder C\\NanoDrop Data\ and all of its subfolders. Contact your PC administrator to give all users Read and Write access to these folders. 		
2. The .log files have been removed from the folder C: \NanoDrop Data\log files\. Replace the .log files if they have been moved. If the .log files can not be located, reinstall this software.		
 The .log files described above are set to read only. Check the properties on each .log file and ensure that the "Read-only" box is unchecked. 		
EXIT		

This error code is most likely to occur if the Windows account that is currently logged into Windows does not have read and write access to the folder c:\nanodrop data or one of its subfolders. See your PC administrator to make sure that all users of the NanoDrop software operate with a Windows account that has the appropriate access.

Can't Find LabView RunTime Engine...

This error message likely means that one or more of the software components have been removed or corrupted. If this occurs, reinstall the Labview Runtime engine by selecting Start \rightarrow Programs \rightarrow NanoDrop \rightarrow Utilities \rightarrow Runtime Installer.

Report Format Loading Error



This error occurs when the user does not have "Write" access to one of the report format files located at c:\nanodrop data\custom report formats or the file has been moved from this folder. This error is similar to Error Code 8 (see above). Contact your PC administrator to give all users Read and Write access to this folder. Replace the files if they have been removed. If the file cannot be located, reinstall the software.

Other Software Error Messages

Can't find file OOIDRV.INI...

This error occurs when trying to install the software without administrator privileges. Contact your system administrator to install the software.

Source Error...

This error indicates that there is insufficient light getting through to make good absorbance measurements. Check that the sampling arm is in the down position and the power is connected.

Error 9003

This error indicates that the monitor resolution is below the 1024x768 required. Check the computer settings. Be sure that the start menu tool bar is set to the bottom and not along the side.

Low Detector Bias...

This occurs when the software has detected a problem with the detector. Contact NanoDrop Technologies or your distributor if you encounter this error.

OOIDRV\ Timeout

This error occurs when a necessary file is deleted as a previous version of the software is uninstalled. Reinstall the newest software to correct the problem.

EZUSB.SYS Cannot Be Found...

If this error message appears, do the following:

- Windows 2000: Type C:\WINNT\INF in the file path text box.
- Windows XP: Type C:\WINDOWS\INF in the file path text box.

This should allow the installation to complete successfully.

Driver X Configuration Failed- You Must Manually Edit the Registry

This error message (or others with similar wording) occurs when attempting to install the operating software on a computer running Windows 2000 or XP. It occurs because the user does not have the necessary authorization to install the software. Contact your system administrator if this occurs.

Insufficient Memory...

This error message (or others with similar wording) occurs when attempting to install the operating software on a computer that does not have at least 40MB of free hard disk space.

No Printer Connected...

This error appears when attempting to print when a printer is not attached to the PC. It is non-fatal and will not cause the software to shut down.

Sample Accuracy and Reproducibility

If you are obtaining results that seem inaccurate or not reproducible, it could be the result of sample or aliquot non-homogeneity or liquid column breakage. It may be helpful to try the following to ensure representative results:

Make sure the sample surfaces are clean before starting the software module

A dirty sample pedestal on startup can cause erroneous absorbance readings (even negative values) and signal saturation. It is always a good practice to clean the sample surfaces with de-ionized water to remove any dried sample that might be present.

Use a 1.5-2 ul sample size

Very strange results can occur when the liquid sample column is not completely formed during a measurement. While making a measurement, visually confirm that the liquid column is formed. If necessary, try 1.5-2 ul samples to ensure the column is formed. Also, proteins and solutions containing surfactants are known to "un-condition" the measurement pedestal surfaces so that the liquid column does not form. If this occurs, "buff" the measurement pedestal surfaces by rubbing each with a dry laboratory wipe 15-20 times. This will "re-condition" the surface allowing for the liquid sample column to form.

Heat DNA samples to 55 °C and vortex before measurement

Due to the small volumes required by the ND-1000, it is extremely important to ensure that the sample being measured is homogeneous. Field experience has shown that samples containing large molecules such as genomic or lambda DNA are particularly susceptible to this phenomenon. Note: Larger volumes used by cuvette-based spectrophotometers will minimize or mask the effect of sample non-homogeneity.

Perform a Blanking Cycle

This will confirm that the instrument is working well and that any sample carryover from previous measurements is not a concern. To run a blanking cycle, perform the following:

- Open the application software module.
- Load an aliquot of the blank (the buffer, solvent, or carrier liquid used with your samples) onto the lower measurement pedestal and lower the sampling arm into the 'down' position.
- Click on the 'Blank' (F3) button to store the blank reference.

- Analyze a fresh replicate of the blanking solution as though it were a sample by selecting 'Measure' (F1). The result should be a spectrum that varies no more than 0.050 A (10mm absorbance equivalent).
- Wipe the blank from both measurement pedestal surfaces with a laboratory wipe and repeat the process until the spectrum is within 0.005 A (1mm path).

Confirm that reference (blank) solution and solvent are the same material

Buffers often absorb in the UV range and therefore it is critical to blank the instrument with exactly the same material that the sample is suspended in.

Confirm that your sample is not too dilute

Measuring samples at or near the detection limit will result in measurements that can vary a significant amount. Refer to the 'Measurement Concentration Range' of the application module that you are using for the applicable measurement range.

Confirm instrument accuracy and reproducibility with CF-1

This is a potassium dichromate calibration standard available from NanoDrop Technologies and its distributors. It is a good practice to check the instrument's performance every six months with a fresh vial of CF-1.

260/280 Ratio

Many researchers encounter a consistent 260/280 ratio change when switching from a standard cuvette spectrophotometer to the NanoDrop[®] ND-1000 spectrophotometer. The three main causes for this are listed below:

Change in sample acidity

Small changes in solution pH will cause the 260:280 to vary^{**}. Acidic solutions will under-represent the 260:280 ratio by 0.2-0.3, while a basic solution will over-represent the ratio by 0.2-0.3. If comparing the NanoDrop[®] ND-1000 Spectrophotometer to other spectrophotometers, it is important to ensure that the pH of an undiluted sample measured on the ND-1000 is at the same pH as the diluted sample measured on the second spectrophotometer.

^{**} William W. Wilfinger, Karol Mackey, and Piotr Chomczynski, Effect of pH and Ionic Strength on the Spectrophotometric Assessment of Nucleic Acid Purity: *BioTechniques* 22:474-481 (March 1997)

Wavelength accuracy of the spectrophotometers

Although the absorbance of a nucleic acid at 260nm is generally on a plateau, the absorbance curve at 280nm is quite steeply sloped. A slight shift in wavelength accuracy will have a large effect on 260:280 ratios. For example, a +/- 1 nm shift in wavelength accuracy will result in a +/- 0.2 change in the 260:280 ratio. Since many spectrophotometers claim a 1 nm accuracy specification, it is possible to see as much as a 0.4 difference in the 260:280 ratio when measuring the same nucleic acid sample on two spectrophotometers that are both within wavelength accuracy specification.

Nucleotide mix in your sample

The five nucleotides that comprise DNA and RNA exhibit widely varying 260:280 ratios³. The following represent the 260:280 ratios estimated for each nucleotide if measured independently:


Guanine:	1.15
Adenine:	4.50
Cytosine:	1.51
Uracil:	4.00
Thymine:	1.47

The resultant 260:280 ratio for the nucleic acid being studied will be approximately equal to the weighted average of the 260:280 ratios for the four nucleotides present. It is important to note that the generally accepted ratios of 1.8 and 2.0 for DNA and RNA are "rules of thumb". The actual ratio will depend on the composition of the nucleic acid. Note: RNA will typically have a higher 260:280 ratio due to the higher ratio of Uracil compared to that of Thymine.

*** Leninger, A. L. *Biochemistry*, 2nd ed., Worth Publishers, New York, 1975

Unusual Spectrum

A sample that exhibits jagged "cuts" out of the spectrum, but an otherwise normal shape, may be the result of detector saturation. This can be caused by the software selecting too high of an integration time due to a dirty sample pedestal upon startup. Try cleaning both sample pedestals thoroughly and restarting the software. For reference, examples of spectra generated with a saturated detector are shown below.

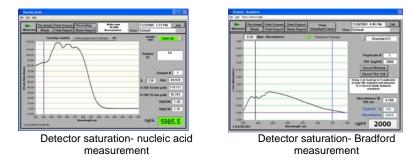

A spectrum that is very "un-smooth" or "ragged" can be caused by insufficient light intensity reaching the spectrometer. If you suspect that this is occurring, refer to the "Technical Service" section for instructions on how to contact NanoDrop Technologies and what information must be sent to allow for diagnosing the problem.

Technical Service

If after referring to the above troubleshooting tips you are unable to resolve your problem, please contact your local distributor or NanoDrop Technologies at <u>info@nanodrop.com</u> for help. The following information will be very helpful:

JPG image of Utilities and Diagnostics module

To get this, open this module and select 'OK' to initialize the module. Select 'Intensity Check'. Once the spectrum has been created, choose File \rightarrow Save Window as shown below. Save to your hard drive and email as an attachment to your distributor or to info@nanodrop.com.



Application Module Screen Captures

Screen captures of the actual spectrum as seen on your PC are of great use in diagnosing problems. Making a screen capture is quite easy. When in an application module, press 'Alt+Print Screen'. This copies the highlighted screen window to the PC's clipboard. Next, paste this screen capture into MS Word, MS Paint (this program usually comes standard with the PC and can usually be found in the Start \rightarrow Accessories menu), or other graphics programs. Save this as a .jpg or .doc file and send as email attachment to your distributor or to info@nanodrop.com.

Data Archive Files

If you have questions about your data, please send the archive file containing the suspect data as an email attachment to your distributor or to info@nanodrop.com. The archived file can be found at C:WanoDrop Data \rightarrow User name \rightarrow Application Module (BCA Protein, Bradford, Cell Culture, Protein Lowry, Proteins and Labels, MicroArray, Nucleic Acid, Protein A-280, UV-Vis or UV-Vis HiAbs).

16. Maintenance and Warranty

Cleaning

The primary maintenance requirement of the NanoDrop® ND-1000 Spectrophotometer is keeping the measurement pedestal surfaces clean. Upon completion of each sample measurement, wipe the sample from the upper and lower pedestals to prevent sample carryover and avoid residue buildup. It is also recommended that both measurement pedestals be cleaned with de-ionized water upon completion of a testing series.

Calibration

Wavelength

The wavelength is auto-calibrated based on known peaks in the xenon lamp spectra each time the software is started. No calibration is required by the user.

Pathlength (Accuracy)

Generally, this is not required as field experience has shown that the path does not change appreciably even after several years of heavy use. However, it is good practice to check the calibration every six months using CF-1 calibration fluid. A calibration check procedure is available from the Downloads section on the Support tab at www.nanodrop.com.

Parts That Require Replacement

In general, the only part that should periodically require replacement is the flash lamp. The flash lamp should last a minimum of 30K measurements. There is no way to test the flash lamp to confirm its remaining life. When the flash lamp fails, the light output will become very erratic or stop altogether.

Warranty

All spectrophotometers and accessories manufactured by NanoDrop Technologies are warranted against manufacturing defects in parts and labor for a period of one year. Preventive Maintenance as well as additional one, two, and three year warranty extensions are available. Plan descriptions can be found at the following link:

www.nanodrop.com.

17. Appendices

Instrument Specifications

- Sample Size: 1microliter
- Path Length: 1 mm (with auto-ranging to 0.2 mm)
- Light Source: Xenon flash lamp
- Detector Type: 2048-element linear silicon CCD array
- Wavelength Range: 220-750 nm
- Wavelength Accuracy: 1 nm
- Wavelength Resolution: 3 nm (FWHM at Hg 546 nm)
- Absorbance Precision: 0.003 absorbance (1mm path)
- Absorbance Accuracy: 2% (at 0.76 absorbance at 257 nm)
- Absorbance Range: 0.02-75 (10 mm equivalent absorbance)
- Detection Limit: 2 ng/microliter (dsDNA)
- Maximum Concentration: 3700 ng/microliter (dsDNA)
- Measurement Cycle Time: 10 seconds
- Dimensions: 20 cm X 15 cm x 12 cm
- Weight: 3 kg
- Sample Pedestal Material of Construction: 303 stainless steel and quartz fiber
- Operating Voltage: 12 Vdc
- Operating Power Consumption: 6 W
- Standby Power Consumption: 1.5 W
- CE Approval: Units sold in Europe, Australia and New Zealand
- UL/CSA Approval: Units sold in N. America, S. America, Asia and Africa
- Included in system: software, compatible with Windows 2000 or XP

Blanking and Absorbance Calculations

When the NanoDrop[®] ND-1000 Spectrophotometer is "blanked", a spectrum is taken of a reference material (blank) and stored in memory as an array of light intensities by wavelength. When a measurement of a sample is taken, the intensity of light that has transmitted through the sample is recorded. The sample intensities along with the blank intensities are used to calculate the sample absorbance according to the following equation:

Absorbance = -log (Intensity_{sample}/Intensity_{blank})

Thus, the measured light intensity of both the sample and of the blank are required to calculate the absorbance at a given wavelength.

Concentration Calculation (Beer's Law)

General

The Beer-Lambert equation is used to correlate the calculated absorbance with concentration:

A = E * b * c

Where **A** is the absorbance represented in absorbance units (A), **E** is the wavelength-dependent molar absorptivity coefficient (or extinction coefficient) with units of liter/mol-cm, **b** is the path length in cm, and **c** is the analyte concentration in moles/liter or molarity (M).

Fluorescent Dyes (Microarray Measurement)

The NanoDrop software uses the general form of the Beer-Lambert equation to calculate fluorescent dye concentrations in the Microarray module. The table of extinction coefficients for each dye is below:

Dye Type	Extinction Coefficient (liter/mol-cm)	Measurement Wavelength (nm)
Cy3	150000	550
Cy5	250000	650
Alexa Fluor 488	71000	495
Alexa Fluor 546	104000	556
Alexa Fluor 555	150000	555
Alexa Fluor 594	73000	590
Alexa Fluor 647	239000	650
Alexa Fluor 660	132000	663
Cy3.5	150000	581
Cy5.5	250000	675

For nucleic acid quantification, the Beer-Lambert equation is modified to use an extinction coefficient with units of ng-cm/ml. Using this extinction coefficient gives a manipulated equation:

c = (A * e)/b

Where **c** is the nucleic acid concentration in ng/microliter, **A** is the absorbance in AU, **e** is the wavelength-dependent extinction coefficient in **ng-cm/microliter** and **b** is the path length in cm.

The generally accepted extinction coefficients for nucleic acids are:

- Double-stranded DNA: 50 ng-cm/ul
- Single-stranded DNA: 33 ng-cm/ul
- RNA: 40 ng-cm/ul

For the NanoDrop[®] ND-1000 Spectrophotometer, path lengths of 1.0 mm and 0.2 mm are used compared to a standard spectrophotometer using a 10.0 mm path. Thus, the NanoDrop[®] ND-1000 Spectrophotometer is capable of measuring samples that are 50 times more concentrated than can be measured in a standard spectrophotometer.

Note: Absorbance data shown in archive files are represented as displayed on the software screen. For Nucleic Acid, Protein A280 and Proteins and Labels modules, data are normalized to a 1.0 cm (10.0 mm) path. For MicroArray, UV-Vis, Protein BCA, Protein Bradford, Protein Lowry and Cell Culture modules the data are normalized to a 0.1 cm (1.0 mm) path. For high absorbance UV-Vis samples, data are normalized to a 0.1 cm (1.0 mm) path.

Solvent Compatibility

The NanoDrop[®] ND-1000 Spectrophotometer is compatible with most solvents typically used in life science laboratories. These include: methanol, ethanol, n-propanol, isopropanol, butanol, acetone, ether, chloroform, carbon tetrachloride, DMSO, DMF, Acetonitrile, THF, toluene, hexane, benzene, sodium hydroxide, sodium hypochlorite (bleach), dilute HCl, dilute HNO3, dilute acetic acid.

All forms of Hydrofluoric Acid (HF) are incompatible, as the fluoride ion will dissolve the quartz fiber optic cable.

Decontamination of Measurement & Optical Surfaces

If decontamination is necessary, a sanitizing solution, such as a 5.25% solution of sodium hypochlorite (bleach – freshly prepared), can be used to ensure that no biologically active material is present on the measurement pedestals. The metal fiber optic fittings are made from 303 stainless steel and are resistant to most common laboratory solvents (see "Solvent Compatibility" appendix).

Setting Up a Dymo 400 Label Writer Printer

To set DYMO default label to print with ND-1000:

- 1. Open Control Panel, then Printers and Faxes
- 2. Right click on Dymo printer then select Properties
- 3. Under General tab, choose 'Printing Preferences' then 'Advanced'. Then set the following:
 - Paper Size: 30256
 - Halftoning: Super Cell
 - Print Quality: Barcodes and Graphics
- 4. Click 'OK' to close this window then click 'Apply'
- 5. Next, click on the 'Advanced' tab. Ensure that 'Enable advanced printing features' box is checked. Then click on 'Printing Defaults' then 'Advanced'. Then set the following:
 - Paper Size: 30256
 - Halftoning: Super Cell
 - **Print Quality:** Barcodes and Graphics
- 6. Click 'OK' to close this window then click 'Apply'
- 7. Last, click on the 'Device Settings' tab and ensure 30256 Shipping Label is selected as the 'Default' label.